

A NOTICE TO PARENTS, GUARDIANS and STAFF
HALF HOLLOW HILLS SCHOOL DISTRICT
Lead Testing of School Drinking Water
March 2021

Safe and healthy school environments can foster healthy and successful children. To protect public health, the Public Health Law and New York State Health Department (NYSDOH) regulations require that all public schools and boards of cooperative educational services (BOCES) test lead levels in water from every outlet that is being used, or could potentially be used, for drinking or cooking. If lead is found at any water outlet at levels above 15 parts per billion (ppb), which is equal to 15 micrograms per liter ($\mu\text{g/L}$), the NYSDOH requires that the school take action to reduce the exposure to lead.

What is first draw testing of school drinking water for lead?

The "on-again, off-again" nature of water use at most schools can raise lead levels in school drinking water. Water that remains in pipes overnight, over a weekend, or over vacation periods stays in contact with lead pipes or lead solder and, as a result, could contain higher levels of lead. This is why schools are required to collect a sample after the water has been sitting in the plumbing system for a certain period of time. This "first draw" sample is likely to show higher levels of lead for that outlet than what you would see if you sampled after using the water continuously. However, even if the first draw sample does not reflect what you would see with continuous usage, it is still important because it can identify outlets that have elevated lead levels.

What are the results of the first draw testing?

Please refer to attached report.

What is being done in response to the results?

Outlets that tested with lead levels above the action level (15 ppb) were removed from service, unless an outlet is a sink faucet needed for handwashing. In that case, a sign was posted at the outlet indicating that the sink is not to be used for drinking.

Where an outlet tested with lead levels above the action level (15 ppb), yet such outlet is required to be potable, the outlet will be temporarily removed from service, scheduled for proper remediation, re-tested, and put back in service when action levels fall within the acceptable range.

Outlets that tested below the action level remain in service with no restrictions.

What are the health effects of lead?

Lead is a metal that can harm children and adults when it gets into their bodies. Lead is a known neurotoxin, particularly harmful to the developing brain and nervous system of children under 6 years old. Lead can harm a young child's growth, behavior, and ability to learn. Lead exposure during pregnancy may contribute to low birth weight and developmental delays in infants. There are many sources of lead exposure in the environment, and it is important to reduce all lead exposures as much as possible. Water

testing helps identify and correct possible sources of lead that contribute to exposure from drinking water.

What are the other sources of lead exposure?

Lead is a metal that has been used for centuries for many purposes, resulting in widespread distribution in the environment. Major sources of lead exposure include lead-based paint in older housing, and lead that built up over decades in soil and dust due to historical use of lead in gasoline, paint, and manufacturing. Lead can also be found in a number of consumer products, including certain types of pottery, pewter, brass fixtures, foods, plumbing materials, and cosmetics. Lead seldom occurs naturally in water supplies but drinking water could become a possible source of lead exposure if the building's plumbing contains lead. The primary source of lead exposure for most children with elevated blood-lead levels is lead-based paint.

Should your child be tested for lead?

The risk to an individual child from past exposure to elevated lead in drinking water depends on many factors; for example, a child's age, weight, amount of water consumed, and the amount of lead in the water. Children may also be exposed to other significant sources of lead including paint, soil and dust. Since blood lead testing is the only way to determine a child's blood lead level, parents should discuss their child's health history with their child's physician to determine if blood lead testing is appropriate. Pregnant women or women of childbearing age should also consider discussing this matter with their physician.

Additional Resources

For more information regarding the testing program or sampling results, contact the Half Hollow Hills Facilities Supervisor Carlo Ferrero at 631-592-3019, or visit the District's website at www.hhh.k12.ny.us.

For information about lead in school drinking water, visit:

http://www.health.ny.gov/environmental/water/drinking/lead/lead_testing_of_school_drinking_water.htm

<http://www.p12.nysed.gov/facplan/LeadTestinginSchoolDrinkingWater.html>

For information about NYS Department of Health Lead Poisoning Prevention, visit:

<http://www.health.ny.gov/environmental/lead/>

For more information on blood lead testing and ways to reduce your child's risk of exposure to lead, see "What Your Child's Blood Lead Test Means":

<http://www.health.ny.gov/publications/2526/>

Half Hollow Hills Central School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #20201

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Half Hollow Hills Central School District
525 Half Hollow Road
Dix Hills, NY 11746

February 2021

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #20201

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Chestnut Hill School

Appendix B – Forest Park Elementary School

Appendix C – Otsego Elementary School

Appendix D – Paumanok Elementary School

Appendix E – Signal Hill Elementary School

Appendix F – Sunquam Elementary School

Appendix G – Vanderbilt Elementary School

Appendix H – Candlewood Middle School

Appendix I – West Hollow Middle School

Appendix J – Half Hollow Hills High School East

Appendix K – Half Hollow Hills High School West

Appendix L – Half Hollow Hills Natatorium

Appendix M – Fran Greenspan Central Administration Center

Appendix N – Half Hollow Hills Transportation Building/Bus Garage and Maintenance Building

March 9, 2021

Carlo Ferrero
Half Hollow Hills CSD
525 Half Hollow Road
Dix Hills, NY 11746

I. Executive Summary

The Half Hollow Hills Central School District has developed their 2020-2021 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Half Hollow Hills Central School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Nurse's Office sinks
- 5) Home Economic classroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Half Hollow Hills Central School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include elementary classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Bathroom sinks - in intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, EnviroScience Consultants, Inc. performed initial water sampling throughout the Half Hollow Hills Central School District from February 23-26, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

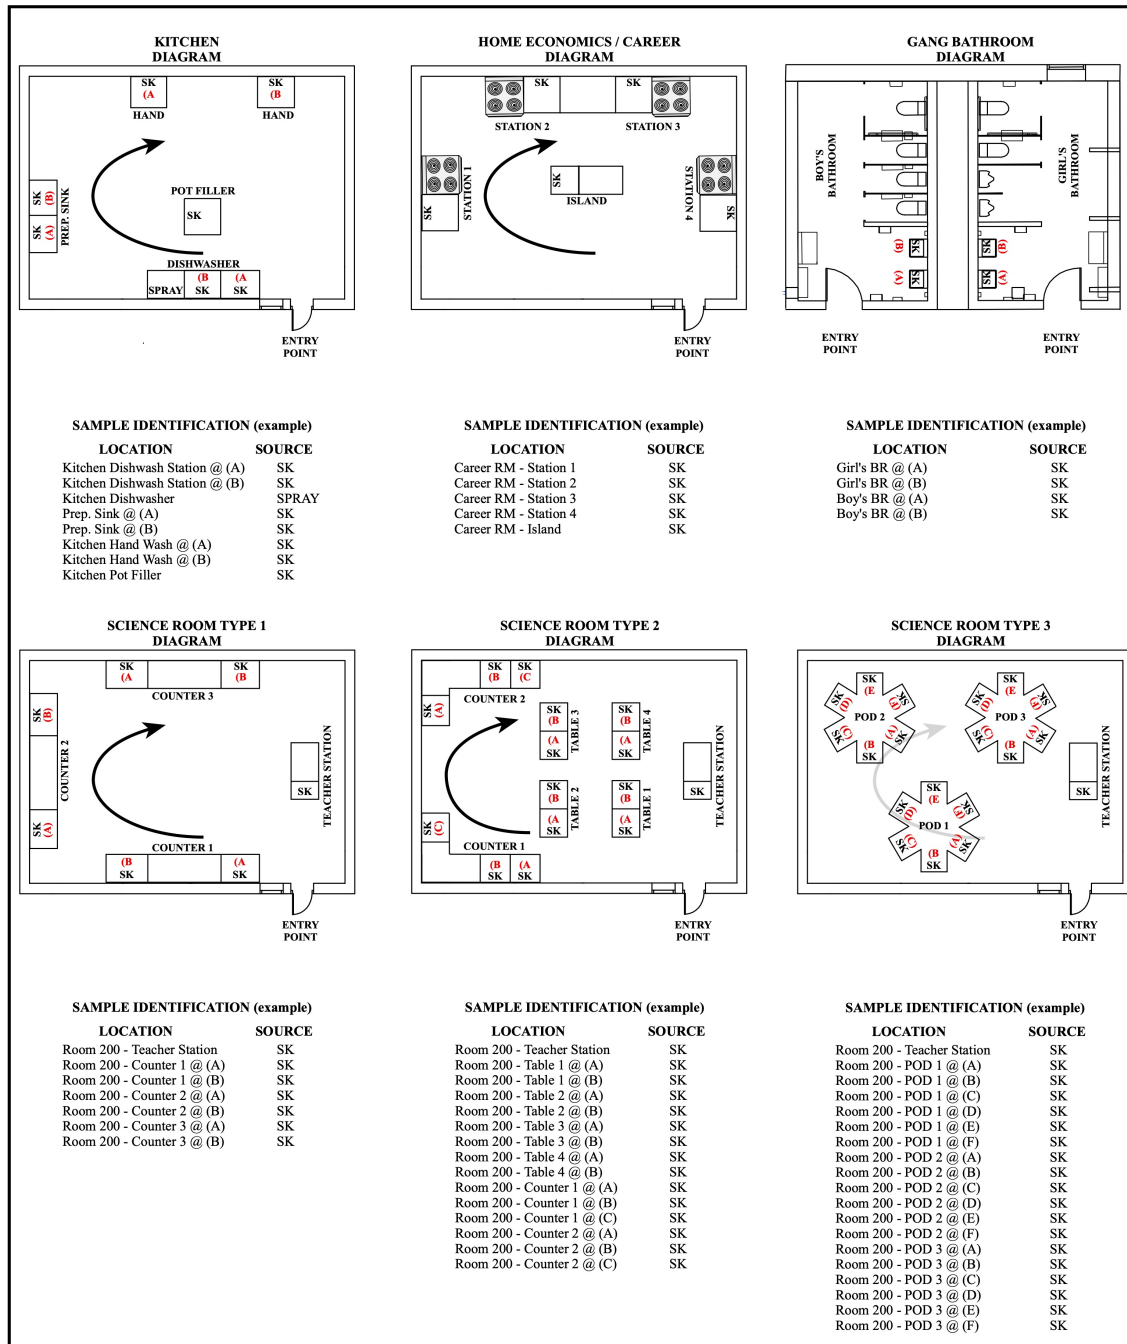

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through N).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Chestnut Hill School

Room 105	WF	57.2
Room 112	WF	21.1
Room 113	WF	31.7
Room 115	WF	25.2

Forest Park Elementary School

No Exceedances

Otsego Elementary School

Kitchen pot filler	PF	21.8
--------------------	----	------

Paumanok Elementary School

No Exceedances

Signal Hill Elementary School

No Exceedances

Sunquam Elementary School

Nurse's Office Exam Room	SK	21.8
--------------------------	----	------

Vanderbilt Elementary School

No Exceedances

Candlewood Middle School

Room 402-Teacher's Station	SK	62.9
Room 402 Prep Room	SK	104
Room 402-Counter @A	SK	38.4
Room 402-Counter @B	SK	35.1
Room 402-Counter @C	SK	58.1
Room 402-Counter @D	SK	71.4
Room 402-Counter @E	SK	65.2
Room 402-Counter @F	SK	65.4
Room 402-Counter @G	SK	47.9

West Hollow Middle School

Kitchen pot filler station @ B	SK	19
Kitchen pot filler station @ C	SK	18.2
Room 223 - Station #2	SK	16.9
Room 223 - Station #3	SK	34.9
Room 223 - Station #4	SK	108
Room 223 - Station #5	SK	17.6
Prep room 223/225 (laundry)	SK	62.6
Room 225 - Station #2	SK	34.1

Half Hollow Hills High School East

East Nurse's Office	SK	189
---------------------	----	-----

Half Hollow Hills High School West

Home Economics Room 151 - Station 4	SK	43.3
--	----	------

Fran Greenspan Administration Building

Mail Room Office Kitchenette	SK	19.9
---------------------------------	----	------

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Custodial Entrance Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-2	Custodial Entrance Custodial Closet	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-1	Kitchen 2-Bay @ A	SPY	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-2	Kitchen 2-Bay @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-3	Kitchen 2-Bay @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-4	Kitchen 3-Bay @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-5	Kitchen 3-Bay @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-6	Kitchen 3-Bay @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-7	Kitchen Handwash	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-8	Kitchen Island	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-9	Kitchen Pot Filler (left)	PF	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-10	Kitchen Pot Filler (right)	PF	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-11	Kitchen Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-12	Kitchen Custodial Closet	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1002-13	Kitchen Custodial Closet	SPY	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1003-1	Bathroom 1	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1004-1	Bathroom 2	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1005-1	Bathroom 3	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1005-2	Bathroom 3	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1006-1	Bathroom 4	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-2	Bathroom 4	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1006-3	Bathroom 4	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1007-1	Hall by Room 201	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1008-1	Art Room 201 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1008-2	Art Room 201 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1008-3	Art Room 201 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1008-4	Art Room 201 @ D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1009-1	Room 228	WF	App		2/23/2021	-	-	-	None	CAPPED	-	-
1009-2	Room 228 Bathroom (left)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1009-3	Room 228 Bathroom (right)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1010-1	Room 202	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1010-2	Room 202	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1011-1	Room 200C	WF	App		2/23/2021	-	-	-	None	CAPPED	-	-
1011-2	Room 200C Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1012-1	Room 205	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1013-1	Custodial Closet by Room 205	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1014-1	Bathroom 5	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1015-1	Bathroom 6 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1015-2	Bathroom 6 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1015-3	Bathroom 6 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1015-4	Bathroom 6 @ D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1015-5	Bathroom 6 @ E	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1016-1	Bathroom 7	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1017-1	Hall by Bathroom 7	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1017-2	Hall by Bathroom 7	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1018-1	Custodial Closet by Bathroom 7	SS	N/A		2/23/2021	-	-	-	None	LOCKED DOOR	-	-
1019-1	Bathroom 8 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1019-2	Bathroom 8 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1019-3	Bathroom 8 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1019-4	Bathroom 8 @ D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1019-5	Bathroom 8 @ E	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1020-1	Room 211 Staff Lounge	WC	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1021-1	Room 212	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1022-1	Room 213	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1023-1	Room 214	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1024-1	Room 210	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1025-1	Room 209	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1026-1	Room 211-Storage	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1027-1	Room 212-Storage	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1028-1	Room 207	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1029-1	Room 206	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1030-1	Teacher's Room	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1031-1	Room 123	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1032-1	Room 124	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1032-2	Room 124	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1033-1	Hall by Nurse	WF	App	6.48	2/23/2021	-	-	-	None	-	-	-
1033-2	Hall by Nurse	BF	App	5.53	2/23/2021	-	-	-	None	-	-	-
1034-1	Nurse's Office	WC	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1034-2	Nurse's Office	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1034-3	Nurse's Office Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1035-1	Main Office Break Room	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1036-1	Principal's Office Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1037-1	Room 101	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1037-2	Room 101	WF	App	14.2	2/23/2021	-	-	-	None	-	-	-
1038-1	Room 102	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1038-2	Room 102	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1039-1	Hall by Room 103	WF	App	4.59	2/23/2021	-	-	-	None	-	-	-
1039-2	Hall by Room 103	BF	App	3.27	2/23/2021	-	-	-	None	-	-	-
1040-1	Room 103	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1040-2	Room 103	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1041-1	Room 104	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1041-2	Room 104	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1042-1	Room 105	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1042-2	Room 105	WF	App	57.2	2/23/2021				Additional Sampling Required			
1043-1	Room 106	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1043-2	Room 106	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1044-1	Room 107	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1044-2	Room 107	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1045-1	Room 110	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1045-2	Room 110	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1046-1	Room 112 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-2	Room 112 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-3	Room 112 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-4	Room 112 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-5	Room 112	WF	App	21.1	2/23/2021				Additional Sampling Required			
1047-1	Room 113	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1047-2	Room 113 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1047-3	Room 113	WF	App	31.7	2/23/2021				Additional Sampling Required			
1048-1	Custodial Closet by Room 113	SS	N/A		2/23/2021	-	-	-	None	LOCKED DOOR	-	-
1049-1	Hall by Room 113	WF	App	5.63	2/23/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1049-2	Hall by Room 113	BF	App	6.03	2/23/2021	-	-	-	None	-	-	-
1050-1	Women's Bathroom by Room 113	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1051-1	Boy's Bathroom by Room 113 (left)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1051-2	Boy's Bathroom by Room 113 (right)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1052-1	Girl's Bathroom by Room 113 (left)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1052-2	Girl's Bathroom by Room 113 (right)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1053-1	Room 114	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1053-2	Room 114	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1053-3	Room 114 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1054-1	Room 115	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1054-2	Room 115	WF	App	25.2	2/23/2021				Additional Sampling Required			
1054-3	Room 115 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1055-1	Room 111	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1055-2	Room 111	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-1	Room 116	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1056-2	Room 116	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1057-1	Room 117	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1057-2	Room 117	WF	App		2/23/2021	-	-	-	None	CAPPED	-	-
1058-1	Room 118	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1058-2	Room 118	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1059-1	Room 119	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1059-2	Room 119	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1060-1	Library Kitchenette	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1060-2	Library Kitchenette	BF	App	<1.0	2/23/2021	-	-	-	None		-	-
1061-1	Room 109	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1061-2	Room 109	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1062-1	Room 108	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1062-2	Room 108	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1063-1	Women's Bathroom by Room 108 (left)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1063-2	Women's Bathroom by Room 108 (right)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1064-1	Men's Bathroom by room 108	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1065-1	Girl's Bathroom by Room 120 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1065-2	Girl's Bathroom by Room 120 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1065-3	Girl's Bathroom by Room 120 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1066-1	Boy's Bathroom by Room 120 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1066-2	Boy's Bathroom by Room 120 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1066-3	Boy's Bathroom by Room 120 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1066-4	Boy's Bathroom by Room 120 @ D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1067-1	Hall by Room 120	WF	App	2.17	2/23/2021	-	-	-	None	-	-	-
1067-2	Hall by Room 120	BF	App	2.55	2/23/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1068-1	Room 120	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1068-2	Room 120	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1069-1	Room 121	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1069-2	Room 121	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1070-1	Room 122	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1070-2	Room 122	WF	App		2/23/2021	-	-	-	None	CAPPED	-	-

Laboratory Report

NYE Report #: 2210750-17006

February 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Chestnut Hill School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 24, 2021. New York Environmental analyzed the samples on February 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	23 Feb 2021
Date Received:	24 Feb 2021
Date Analyzed:	25 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210224P001	1	Hall by Room 201-BF; Initial	1.00	<1.00	µg/L	
210224P002	2	Hall by Bathroom 7-BF; Initial	1.00	<1.00	µg/L	
210224P003	3	Room 211 Staff Lounge-WC; Initial	1.00	<1.00	µg/L	
210224P004	4	Hall by Nurse-WF; Initial	1.00	6.48	µg/L	
210224P005	5	Hall by Nurse-BF; Initial	1.00	5.53	µg/L	
210224P006	6	Nurse's Office -WC; Initial	1.00	<1.00	µg/L	
210224P007	7	Room 101-WF; Initial	1.00	14.2	µg/L	
210224P008	8	Hall by Room 103-WF; Initial	1.00	4.59	µg/L	
210224P009	9	Hall by Room 103-BF; Initial	1.00	3.27	µg/L	
210224P010	10	Room 105-WF; Initial	1.00	57.2	µg/L	E,H
210224P011	11	Room 112-WF; Initial	1.00	21.1	µg/L	H
210224P012	12	Room 113-WF; Initial	1.00	31.7	µg/L	H
210224P013	13	Hall by Room 113-WF; Initial	1.00	5.63	µg/L	
210224P014	14	Hall by Room 113-BF; Initial	1.00	6.03	µg/L	
210224P015	15	Room 115-WF; Initial	1.00	25.2	µg/L	H
210224P016	16	Library Kitchenette-BF; Initial	1.00	<1.00	µg/L	
210224P017	17	Hall by Room 120-WF; Initial	1.00	2.17	µg/L	
210224P018	18	Hall by Room 120-BF; Initial	1.00	2.55	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Dishwashing Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-2	Kitchen Dishwashing Station	SPY	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-3	Kitchen Handwash	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-4	Kitchen 3-Bay @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-5	Kitchen 3-Bay @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-6	Kitchen 3-Bay @ B	SPY	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-7	Kitchen Pot Filler	PF	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-8	Kitchen Oven Spigot	PF	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-9	Kitchen Bathroom (left)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-10	Kitchen Bathroom (right)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-11	Kitchen Custodial Closet	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-1	Nurse's Office	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-2	Nurse's Office Bathroom	SK	App	8.83	2/25/2021	-	-	-	None	-	-	-
1003-1	Principal's Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1004-1	Main Office Break Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1005-1	Room 106	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1006-1	Hall by Room 104	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1006-2	Hall by Room 104	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1007-1	Room 104	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-1	Room 101	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1008-2	Room 101 Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1009-1	Room 102	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1009-2	Room 102 Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1010-1	Room 103	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1011-1	Room 105B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1012-1	Room 107	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1013-1	Room 108	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1014-1	Room 109	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1015-1	Room 111	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1016-1	Room 115	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1017-1	Girl's Bathroom by Room 117 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1017-2	Girl's Bathroom by Room 117 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1017-3	Girl's Bathroom by Room 117 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1017-4	Girl's Bathroom by Room 117 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1017-5	Girl's Bathroom by Room 117 @E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1018-1	Faculty Bathroom by Room 117	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1019-1	Custodial Closet by Room 117	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1020-1	Boy's Bathroom by Room 117 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1020-2	Boy's Bathroom by Room 117 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1020-3	Boy's Bathroom by Room 117 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-4	Boy's Bathroom by Room 117 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1020-5	Boy's Bathroom by Room 117 @E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1021-1	Hall by Room 117 (right)	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-2	Hall by Room 117 (left)	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-3	Hall by Room 117 (left)	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1022-1	Room 117	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1023-1	Room 119	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1024-1	Room 121	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1025-1	Room 120	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1026-1	Room 118	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1027-1	Room 116	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-1	Room 114	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1029-1	Room 112	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1030-1	Room 110	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-1	Boy's Bathroom by Room 110 (left)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-2	Boy's Bathroom by Room 110 (right)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-1	Custodial Closet by Room 110	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1033-1	Faculty Bathroom by Room 110	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1034-1	Girl's Bathroom by Room 110 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1034-2	Girl's Bathroom by Room 110 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1034-3	Girl's Bathroom by Room 110 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-1	Assistant Principal's Office	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-1	Women's Bathroom by Gym	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1037-1	Men's Bathroom by Gym	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1038-1	Girl's Bathroom by Gym @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1038-2	Girl's Bathroom by Gym @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1038-3	Girl's Bathroom by Gym @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1039-1	Custodial Closet by Gym	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1040-1	Boy's Bathroom by Gym @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1040-2	Boy's Bathroom by Gym @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1040-3	Boy's Bathroom by Gym @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-1	Room 21	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-1	Hall by Room 19	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1042-2	Hall by Room 19	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1043-1	Room 19	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1044-1	Room 17	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1045-1	Room 15	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1046-1	Room 13	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1047-1	Room 11	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1048-1	Room 10	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1049-1	Room 12	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-1	Room 14	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1051-1	Room 16	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1052-1	Boy's Bathroom in Hexagon (left)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1052-2	Boy's Bathroom in Hexagon (right)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1053-1	Girl's Bathroom in Hexagon (left)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1053-2	Girl's Bathroom in Hexagon (right)	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1054-1	Men's Bathroom in Hexagon	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1055-1	Women's Bathroom in Hexagon	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1056-1	Hall to Hexagon	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-2	Hall to Hexagon	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1057-1	Room 4	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1058-1	Room 3	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1059-1	Room 2	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1060-1	Room 1	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1061-1	Room 9	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1062-1	Room 8	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1063-1	Custodial Closet in Hexagon	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1064-1	Room 7	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1065-1	Room 6	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1066-1	Room 5	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1067-1	Room 18	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1068-1	Room 20 Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1069-1	Room 200E Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1070-1	Faculty Lounge	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1071-1	Boy's Phys Ed Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1071-2	Boy's Phys Ed Office	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1072-1	Custodial Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210770-17016

February 26, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Forest Park Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 25, 2021. New York Environmental analyzed the samples on February 26, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	25 Feb 2021
Date Received:	25 Feb 2021
Date Analyzed:	26 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210225M031	1	Nurse's Office Bathroom - SK; Initial	1.00	8.83	µg/L	
210225M032	2	Hall by Room 104 - BF ; Initial	1.00	<1.00	µg/L	
210225M033	3	Hall by Room 117 (left)- BF ; Initial	1.00	<1.00	µg/L	
210225M034	4	Hall by Room 19 - BF; Initial	1.00	<1.00	µg/L	
210225M035	5	Hall to Hexagon - BF ; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen pot filler	PF	App	21.8	2/23/2021				Additional Sampling Required			
1001-2	Kitchen bathroom @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-3	Kitchen bathroom @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-4	Kitchen sanitizer station @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-5	Kitchen sanitizer station	SPY	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-6	Kitchen sanitizer station @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-7	Kitchen handwash	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-8	Kitchen canwash closet	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-9	Kitchen 2-bay Prep	SK	App	1.76	2/23/2021	-	-	-	None	-	-	-
1001-10	Kitchen dishwashing station	SPY	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-11	Kitchen dishwashing station	SK	App	8.01	2/23/2021	-	-	-	None	-	-	-
1001-12	Kitchen spigot by fire extinguisher	SP	App	10	2/23/2021	-	-	-	None	-	-	-
1002-1	Faculty room	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1003-1	Receiving area bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1004-1	Women faculty bathroom by exit 4	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1005-1	Men faculty bathroom by exit 4	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1006-1	Copy room bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1006-2	Copy room custodial closet	SS	N/A		2/23/2021	-	-	-	Sign Required	-	-	-
1007-1	Main office kitchenett	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1008-1	Pricipal's office bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1009-1	Hallway by Nurse's office	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1010-1	Nurse's office	SK	App	1.71	2/23/2021	-	-	-	None	-	-	-
1010-2	Nurse's office bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1011-1	Room 108	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1011-2	Room 108	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-1	Room 107	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1012-2	Room 107	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1013-1	Room 106	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1013-2	Room 106	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1014-1	Room 105	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1014-2	Room 105	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1015-1	Custodial closet by Room 105	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1016-1	Hallway by Room 105	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1017-1	Room 104	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1017-2	Room 104	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1017-3	Room 104 bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1018-1	Room 103	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1018-2	Room 103	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1018-3	Room 103 bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1019-1	Room 102	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1019-2	Room 102	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1019-3	Room 102 bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1020-1	Room 101	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1020-2	Room 101	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1020-3	Room 101 bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1021-1	Room 109	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1021-2	Room 109	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1022-1	Girl's bathroom by Room 109 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1022-2	Girl's bathroom by Room 109 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1023-1	Faculty bathroom by Room 109	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1024-1	Hallway by Room 110	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1025-1	Server closet	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1026-1	Boy's bathroom by Room 111 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1026-2	Boy's bathroom by Room 111 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1026-3	Boy's bathroom by Room 111 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1027-1	Room 110	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1027-2	Room 110	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1028-1	Room 111	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1028-2	Room 111	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1029-1	Room 112	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1029-2	Room 112	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1030-1	Room 113	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1030-2	Room 113	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1031-1	Room 114	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1031-2	Room 114	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1032-1	Room 116	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1032-2	Room 116	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1033-1	Girl's bathroom by Room 116 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1033-2	Girl's bathroom by Room 116 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1033-3	Girl's bathroom by Room 116 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1033-4	Girl's bathroom by Room 116 @ D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1033-5	Girl's bathroom by Room 116 @ E	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1034-1	Faculty bathroom by Room 116	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1035-1	Hallway by Room 116 (left)	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1035-2	Hallway by Room 116 (left)	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1035-3	Hallway by Room 116 (right)	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1036-1	Custodial closet by Room 116	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1037-1	Boy's bathroom by Room 117 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1037-2	Boy's bathroom by Room 117 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1037-3	Boy's bathroom by Room 117 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1037-4	Boy's bathroom by Room 117 @ D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1037-5	Boy's bathroom by Room 117 @ E	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1038-1	Room 117	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1038-2	Room 117	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1039-1	Room 118	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1039-2	Room 118	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1040-1	Room 119	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1040-2	Room 119	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1041-1	Room 120	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1041-2	Room 120	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1042-1	Hallway by Room 200A	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1042-2	Hallway by Room 200A	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1043-1	Room 201	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1043-2	Room 201	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1044-1	Girl's bathroom by Room 201 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1044-2	Girl's bathroom by Room 201 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1044-3	Girl's bathroom by Room 201 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1045-1	Custodial closet by Room 201	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-1	Boy's bathroom by Room 201 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-2	Boy's bathroom by Room 201 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1046-3	Boy's bathroom by Room 201 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1047-1	Physical Education office bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1048-1	Room 202	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1048-2	Room 202	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1049-1	Room 203	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1049-2	Room 203	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1049-3	Room 203	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1050-1	Room 204	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1050-2	Room 204	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1051-1	Room 205	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1052-1	Room 206	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1053-1	Room 207	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1054-1	Room 208	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1055-1	Room 209	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1056-1	Room 210	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1057-1	Room 211	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1058-1	Hallway by Room 301	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1059-1	Girl's bathroom by Room 309 @ A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1059-2	Girl's bathroom by Room 309 @ B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1059-3	Girl's bathroom by Room 309 @ C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1060-1	Room 309	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1061-1	Room 308	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1062-1	Custodial closet by Room 308	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1063-1	Room 307	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1064-1	Boy's bathroom by Room 307 @ A	SK	N/A		2/23/2021	-	-	-	Sign Required	-	-	-
1064-2	Boy's bathroom by Room 307 @ B	SK	N/A		2/23/2021	-	-	-	Sign Required	-	-	-
1065-1	Room 305A	SK	App	3.07	2/23/2021	-	-	-	None	-	-	-
1066-1	Hallway across from Room 305A	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1067-1	Faculty bathroom by Room 305	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1068-1	Room 305	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1069-1	Room 304	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1070-1	Room 303/302 (Library)	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1071-1	Room 301	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1072-1	Women faculty bathroom by Room 301	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210751-17007

February 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Otsego Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 24, 2021. New York Environmental analyzed the samples on February 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	23 Feb 2021
Date Received:	24 Feb 2021
Date Analyzed:	25 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210224P021	1	Kitchen pot filler-PF; Initial	1.00	21.8	µg/L	H
210224P022	2	Kitchen 2-bay Prep-SK; Initial	1.00	1.76	µg/L	
210224P023	3	Kitchen dishwashing station-SK; Initial	1.00	8.01	µg/L	
210224P024	4	Kitchen spigot by fire extinguisher-SP; Initial	1.00	10.0	µg/L	
210224P025	5	Nurse's office-SK; Initial	1.00	1.71	µg/L	
210224P026	6	Hallway by Room 116 (left)-BF; Initial	1.00	<1.00	µg/L	
210224P027	7	Hallway by Room 200A-BF; Initial	1.00	<1.00	µg/L	
210224P028	8	Hallway by Room 301-BF; Initial	1.00	<1.00	µg/L	
210224P029	9	Room 305A-SK; Initial	1.00	3.07	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix D

Half Hollow Hills CSD
Paumanok Elementary School

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen-2 Sink Unit- Left	SK	App	2.61	2/23/2021	-	-	-	None	-	-	-
1001-2	Kitchen-2 Sink Unit- Right	SK	App	1.63	2/23/2021	-	-	-	None	-	-	-
1001-3	Kitchen-3 Sink Unit-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-4	Kitchen-3 Sink Unit-Middle	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-5	Kitchen-3 Sink Unit-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-6	Kitchen Handwash	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-7	Kitchen Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-8	Kitchen-Serving Area	SPY	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-9	Kitchen-Serving Area-Single Unit	SK	App	5.76	2/23/2021	-	-	-	None	-	-	-
1001-10	Kitchen-Custodial Closet	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1001-11	Kitchen-Pot Filler	PF	App	7.88	2/23/2021	-	-	-	None	-	-	-
1001-12	Kitchen-Prep Island	SK	App	3.52	2/23/2021	-	-	-	None	-	-	-
1001-13	Kitchen-Pot Filler Hose by Stove	PF	App	13.7	2/23/2021	-	-	-	None	-	-	-
1002-1	Cafeteria	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1002-2	Cafeteria	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1003-1	Gender Neutral Bathroom by Cafeteria	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1004-1	Women's Bathroom by Cafeteria	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1005-1	Boy's Bathroom by Art Room 199-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1005-2	Boy's Bathroom by Art Room 199-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1006-1	Girl's Bathroom by Art Room 199-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-2	Girl's Bathroom by Art Room 199-Middle	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1006-3	Girl's Bathroom by Art Room 199-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1007-1	Hallway by Art Room 199	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1008-1	Art Room 199-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1008-2	Art Room 199-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1009-1	Boy's Coach's Office Bathroom-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1009-2	Boy's Coach's Office Bathroom-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1010-1	Girl's Coach's Office Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1011-1	Custodial Closet by Room 202	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1012-1	Girl's Bathroom by Room 202-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1012-2	Girl's Bathroom by Room 202-Middle	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1012-3	Girl's Bathroom by Room 202-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1013-1	Boy's Bathroom by Room 202-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1013-2	Boy's Bathroom by Room 202-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1014-1	Room 204	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1014-2	Room 204	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1015-1	Room 206	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1015-2	Room 206	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1016-1	Room 207	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1016-2	Room 207	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-1	Girl's Bathroom by Room 207 @A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1017-2	Girl's Bathroom by Room 207 @B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1017-3	Girl's Bathroom by Room 207 @C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1017-4	Girl's Bathroom by Room 207 @D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1017-5	Girl's Bathroom by Room 207 @E	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1018-1	Faculty Bathroom by Room 207	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1019-1	Hallway by Room 305-Left	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1019-2	Hallway by Room 305-Left	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1019-3	Hallway by Room 305-Right	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1020-1	Custodial Closet by Room 305	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1021-1	Boy's Bathroom by Room 305 @A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1021-2	Boy's Bathroom by Room 305 @B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1021-3	Boy's Bathroom by Room 305 @C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1021-4	Boy's Bathroom by Room 305 @D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1021-5	Boy's Bathroom by Room 305 @E	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1022-1	Room 305	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1022-2	Room 305	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1023-1	Room 306	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1023-2	Room 306	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1024-1	Room 307	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-2	Room 307	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1025-1	Room 308	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1025-2	Room 308	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1026-1	Room 304	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1026-2	Room 304	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1027-1	Room 303	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1027-2	Room 303	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1028-1	Room 302	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1028-2	Room 302	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1029-1	Room 301	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1029-2	Room 301	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1030-1	Room 205	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1030-2	Room 205	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1031-1	Room 203	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1031-2	Room 203	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1032-1	Room 202	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1032-2	Room 202	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1033-1	Room 201	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1033-2	Room 201	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1034-1	Room 109	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1034-2	Room 109	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1035-1	Room 121	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1035-2	Room 121	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1036-1	Room 122	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1036-2	Room 122	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1037-1	Room 123	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1037-2	Room 123	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1038-1	Room 124	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1038-2	Room 124	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1039-1	Room 111	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1039-2	Room 111	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1040-1	Room 115	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1040-2	Room 115	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1040-3	Room 115 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1041-1	Room 114	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1041-2	Room 114	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1041-3	Room 114 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1042-1	Girl's Bathroom by Room 114-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1042-2	Girl's Bathroom by Room 114-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1043-1	Boy's Bathroom by Room 114-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1043-2	Boy's Bathroom by Room 114-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1044-1	Women's Bathroom by Room 114-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1044-2	Women's Bathroom by Room 114-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1045-1	Custodial Closet by Room 113	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-1	Room 113	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1046-2	Room 113	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1046-3	Room 113 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1047-1	Room 112	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1047-2	Room 112	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1047-3	Room 112 Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1048-1	Room 107	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1048-2	Room 107	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1049-1	Room 110	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1049-2	Room 110	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1050-1	Room 106	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1050-2	Room 106	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1051-1	Room 105	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1051-2	Room 105	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1052-1	Room 104	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1052-2	Room 104	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1053-1	Room 108	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1053-2	Room 108	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1054-1	Room 103	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1054-2	Room 103	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1055-1	Gender Neutral Bathroom by Room 103	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1056-1	Women's Bathroom by Room 103-Left	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1056-2	Women's Bathroom by Room 103-Right	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1057-1	Hallway by Speech Room 100	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1058-1	Library Server Room	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1059-1	Room 102	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1059-2	Room 102	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1060-1	Room 101	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1060-2	Room 101	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1061-1	Principle's Office bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1062-1	Main Office Kitchenette	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1063-1	Nurse's Office Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1063-2	Nurse's Office Exam Room	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1063-3	Nurse's Office	SK	App	<1.0	2/23/2021	-	-	-	None	-	-	-
1064-1	Custodial Closet by Nurse's Office	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1065-1	Hallway by Nurse's Office	BF	App	<1.0	2/23/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1066-1	Room 116	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1066-2	Room 116	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1067-1	Room 117	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1067-2	Room 117	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1068-1	Room 118	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1068-2	Room 118	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1069-1	Room 119	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1069-2	Room 119	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1070-1	Room 120	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1070-2	Room 120	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1071-1	Boy's Bathroom by Room 120 @A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1071-2	Boy's Bathroom by Room 120 @B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1071-3	Boy's Bathroom by Room 120 @C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1071-4	Boy's Bathroom by Room 120 @D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1071-5	Boy's Bathroom by Room 120 @E	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1072-1	Hallway by Room 120	WF	App		2/23/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1073-1	Girl's Bathroom by Room 120 @A	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1073-2	Girl's Bathroom by Room 120 @B	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1073-3	Girl's Bathroom by Room 120 @C	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1073-4	Girl's Bathroom by Room 120 @D	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1074-1	Faculty Room Kitchenette	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1074-2	Faculty Room Kitchenette	SPY	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1075-1	Custodial Office	SS	N/A		2/23/2021	-	-	-	None	SIGN	-	-
1075-2	Custodial Office Bathroom	SK	N/A		2/23/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210755-17011

February 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Paumanok Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 24, 2021. New York Environmental analyzed the samples on February 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Feb 2021
Date Received:	24 Feb 2021
Date Analyzed:	25 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210224Q018	1	Kitchen-2 Sink Unit- Left-SK; Initial	1.00	2.61	µg/L	
210224Q019	2	Kitchen-2 Sink Unit- Right-SK; Initial	1.00	1.63	µg/L	
210224Q020	3	Kitchen-Serving Area-Single Unit-SK; Initial	1.00	5.76	µg/L	
210224Q021	4	Kitchen-Pot Filler-PF; Initial	1.00	7.88	µg/L	
210224Q022	5	Kitchen-Prep Island-SK; Initial	1.00	3.52	µg/L	
210224Q023	6	Cafeteria-BF; Initial	1.00	<1.00	µg/L	
210224Q024	7	Hallway by Room 305-Left-BF; Initial	1.00	<1.00	µg/L	
210224Q025	8	Nurse's Office-SK; Initial	1.00	<1.00	µg/L	
210224Q026	9	Hallway by Nurse's Office-BF; Initial	1.00	<1.00	µg/L	
210224Q027	10	Kitchen-Pot Filler Hose by Stove-PF; Initial	1.00	13.7	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix E

Half Hollow Hills CSD
Signal Hill Elementary School

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen-Pot Filler Hose	PF	App	4.42	2/24/2021	-	-	-	None	-	-	-
1001-2	Kitchen-Pot Filler	SK	App	6.99	11/4/2020	-	-	-	None	-	-	-
1001-3	Kitchen Bathroom-Left	SK	N/A		11/4/2020	-	-	-	None	SIGN	-	-
1001-4	Kitchen Bathroom-Right	SK	N/A		11/4/2020	-	-	-	None	SIGN	-	-
1001-5	Kitchen 3-Bay-Left	SK	N/A		11/4/2020	-	-	-	None	SIGN	-	-
1001-6	Kitchen 3-Bay-Right	SK	N/A		11/4/2020	-	-	-	None	SIGN	-	-
1001-7	Kitchen 3-Bay	SPY	N/A		11/4/2020	-	-	-	None	SIGN	-	-
1001-8	Kitchen-Handwash	SK	N/A		11/4/2020	-	-	-	None	SIGN	-	-
1001-9	Kitchen- Custodial Closet	SS	N/A		11/4/2020	-	-	-	None	SIGN	-	-
1001-10	Kitchen-2 Bay	SK	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1001-11	Kitchen-Serving Area-Handwash	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1002-1	Cafeteria	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1003-1	Faculty Room	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1004-1	Men's Bathroom by Kitchen	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1005-1	Women's Bathroom by Kitchen	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1006-1	Custodial Office Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1007-1	Band Room Custodial Closet	SS	N/A		2/24/2021	-	-	-	Sign Required	-	-	-
1008-1	Coach's Office Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1009-1	Main Office Kitchenette	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1010-1	Principle's Office Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-1	Hallway by Nurse's Office	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-1	Nurse's Office	SK	App	3.47	2/24/2021	-	-	-	None	-	-	-
1012-2	Nurse's Office Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1013-1	Room 201 Coach's Office Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1014-1	Room 201 Bathroom	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1014-2	Room 201 Bathroom-Left	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1014-3	Room 201 Bathroom-Right	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1015-1	Room 203	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1016-1	Room 206	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1016-2	Room 206	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1017-1	Room 208	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1017-2	Room 208	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1018-1	Room 210	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1018-2	Room 210	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1019-1	Room 211	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1019-2	Room 211	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1020-1	Room 209	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1020-2	Room 209	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-1	Room 207	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1021-2	Room 207	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1022-1	Room 205	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1022-2	Room 205	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1023-1	Room 204	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1023-2	Room 204	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1024-1	Room 202	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1024-2	Room 202	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1025-1	Boy's Bathroom by Room 201 @A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1025-2	Boy's Bathroom by Room 201 @B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1025-3	Boy's Bathroom by Room 201 @C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1025-4	Boy's Bathroom by Room 201 @D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1026-1	Custodial Closet by Room 201	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1027-1	Girl's Bathroom by Room 201 @A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1027-2	Girl's Bathroom by Room 201 @B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1027-3	Girl's Bathroom by Room 201 @C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1027-4	Girl's Bathroom by Room 201 @D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1028-1	Hallway by Gym	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1029-1	Library	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1030-1	Girl's Bathroom by Room 109 @A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1030-2	Girl's Bathroom by Room 109 @B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1030-3	Girl's Bathroom by Room 109 @C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-1	Faculty Bathroom by Room 109	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1032-1	Custodial Closet by Room 110	SS	N/A		2/24/2021	-	-	-	None	LOCKED DOOR	-	-
1033-1	Boy's Bathroom by Room 110 @A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1033-2	Boy's Bathroom by Room 110 @B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1033-3	Boy's Bathroom by Room 110 @C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1034-1	Hallway by Room 110	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1035-1	Room 111	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1035-2	Room 111	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1036-1	Room 114	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1036-2	Room 114	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1037-1	Room 116	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1037-2	Room 116	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1038-1	Room 118	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1038-2	Room 118	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1039-1	Room 119	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1039-2	Room 119	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1040-1	Room 121	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1040-2	Room 121	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1041-1	Girl's Bathroom by Room 122 @A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1041-2	Girl's Bathroom by Room 122 @B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1041-3	Girl's Bathroom by Room 122 @C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1041-4	Girl's Bathroom by Room 122 @D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1041-5	Girl's Bathroom by Room 122 @E	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1042-1	Faculty Bathroom by Room 122	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1043-1	Hallway by Room 122-Left	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1043-2	Hallway by Room 122-Left	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1043-3	Hallway by Room 122-Right	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1044-1	Custodial Closet by Room 122	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-1	Boy's Bathroom by Room 123 @A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-2	Boy's Bathroom by Room 123 @B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-3	Boy's Bathroom by Room 123 @C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-4	Boy's Bathroom by Room 123 @D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-5	Boy's Bathroom by Room 123 @E	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1046-1	Room 123	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1046-2	Room 123	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1047-1	Room 125	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1047-2	Room 125	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1048-1	Room 126	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1048-2	Room 126	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1049-1	Room 124	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1049-2	Room 124	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1050-1	Room 122	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1050-2	Room 122	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1051-1	Room 120	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1051-2	Room 120	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1052-1	Room 117	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1052-2	Room 117	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1053-1	Room 115	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1053-2	Room 115	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1054-1	Room 113	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1054-2	Room 113	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1055-1	Room 112	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1055-2	Room 112	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-1	Room 110	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1056-2	Room 110	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1057-1	Room 109	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1057-2	Room 109	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1058-1	Room 108A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1058-2	Room 108A	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1059-1	Room 106	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1059-2	Room 106	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1060-1	Custodial Closet by Room 104	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1061-1	Room 104 Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1061-2	Room 104	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1061-3	Room 104	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1062-1	Hallway by Room 104	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1063-1	Room 105	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1063-2	Room 105	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1064-1	Room 107	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1064-2	Room 107	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1065-1	Room 103 Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1065-2	Room 103	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1065-3	Room 103	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1066-1	Room 102	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1066-2	Room 102 Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1066-3	Room 102	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1067-1	Room 101	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1067-2	Room 101 Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1067-3	Room 101	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210752-17008

February 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Signal Hill Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 24, 2021. New York Environmental analyzed the samples on February 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Feb 2021
Date Received:	24 Feb 2021
Date Analyzed:	25 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210224P030	1	Kitchen-Pot Filler Hose-PF; Initial	1.00	4.42	µg/L	
210224P031	2	Kitchen-Pot Filler-SK; Initial	1.00	6.99	µg/L	
210224P032	3	Kitchen-2 Bay-SK; Initial	1.00	<1.00	µg/L	
210224P033	4	Cafeteria-BF; Initial	1.00	<1.00	µg/L	
210224P034	5	Nurse's Office-SK; Initial	1.00	3.47	µg/L	
210224P035	6	Hallway by Room 122-Left-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix F

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash 1	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-2	Kitchen 3-Bay @A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-3	Kitchen 3-Bay @B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-4	Kitchen 2-Bay	SK	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1001-5	Kitchen Handwash 2	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-6	Kitchen Island	SK	App	8.31	2/24/2021	-	-	-	None	-	-	-
1001-7	Kitchen Pot Filler	PF	App	2	2/24/2021	-	-	-	None	-	-	-
1001-8	Kitchen Handwash 3	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-9	Kitchen Serving Line Handwash 1	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-10	Kitchen Serving Line Handwash 2	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-11	Kitchen Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-12	Kitchen Custodial Closet	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1002-1	Faculty Room	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1002-2	Faculty Room Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1003-1	Room 206	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1004-1	Girl's Bathroom by Room 206 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1004-2	Girl's Bathroom by Room 206 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1004-3	Girl's Bathroom by Room 206 @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1005-1	Custodial Closet by Room 205	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1006-1	Boy's Bathroom by Room 205 (left)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-2	Boy's Bathroom by Room 205 (right)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1007-1	Room 205	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1008-1	Hall by Room 205	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1008-2	Hall by Room 205	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1009-1	Room 204	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1010-1	Room 201	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1011-1	Room 202	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1012-1	Room 203	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1013-1	Room 4	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1014-1	Room 3	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1015-1	Room 1	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1016-1	Room 2	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1017-1	Principal's Office Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1018-1	Girl's Bathroom by Room 301	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1019-1	Custodial Closet by Room 301	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1020-1	Faculty Bathroom by Room 301	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1021-1	Hall by Room 302	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-2	Hall by Room 302	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1022-1	Room 301	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1023-1	Room 302	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-1	Room 303	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1025-1	Room 304	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1026-1	Custodial Closet by Room 105	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1027-1	Room 105	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1028-1	Room 106	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1029-1	Room 107	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1030-1	Room 108 Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1031-1	Room 109	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1032-1	Room 110	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1033-1	Room 111	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1034-1	Hall by Room 112	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1035-1	Bathroom by Room 112	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1036-1	Room 113	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1037-1	Room 114	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1038-1	Room 115	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1039-1	Room 116	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1040-1	Room 117	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1041-1	Room 118	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1042-1	Room 119	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1043-1	Girl's Bathroom by Room 119 (left)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1043-2	Girl's Bathroom by Room 119 (right)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1044-1	Custodial Closet by Room 119	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-1	Boy's Bathroom by Room 119 (left)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-2	Boy's Bathroom by Room 119 (right)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1046-1	Room 120	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1047-1	Room 121	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1048-1	Room 122	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1049-1	Room 103	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1050-1	Room 102	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1051-1	Room 101	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1052-1	Nurse's Office	SK	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1052-2	Nurse's Office Exam Room	SK	App	28	2/24/2021				Additional Sampling Required			
1053-1	Hall by Physical Education Office	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1054-1	Physical Education Office Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1055-1	Music Room 1 Bathroom (left)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1055-2	Music Room 1 Bathroom (right)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1056-1	Physical Education Office (by Art) Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1057-1	Music Room 2 Bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1058-1	Art Room (left)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1058-2	Art Room (right)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1059-1	Custodial Office	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1060-1	Hill Vestibule	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1060-2	Hill Vestibule	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1060-3	Hill Vestibule Custodial Closet	SS	App		2/24/2021	-	-	-	None	LOCKED DOOR	-	-
1061-1	Room 410 (left)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1061-2	Room 410 (right)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1061-3	Room 410 Bathroom	SK	N/A		2/24/2021	-	-	-	Sign Required	-	-	-
1062-1	Room 402 (left)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1062-2	Room 402 (right)	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1062-3	Room 402 Bathroom	SK	N/A		2/24/2021	-	-	-	Sign Required	-	-	-

Laboratory Report

NYE Report #: 2210754-17010

February 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Sunquam Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 24, 2021. New York Environmental analyzed the samples on February 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Feb 2021
Date Received:	24 Feb 2021
Date Analyzed:	25 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210224Q009	1	Kitchen 2-Bay-SK; Initial	1.00	<1.00	µg/L	
210224Q010	2	Kitchen Island-SK; Initial	1.00	8.31	µg/L	
210224Q011	3	Kitchen Pot Filler-PF; Initial	1.00	2.00	µg/L	
210224Q012	4	Hall by Room 205-BF; Initial	1.00	<1.00	µg/L	
210224Q013	5	Hall by Room 302-BF; Initial	1.00	<1.00	µg/L	
210224Q014	6	Hall by Room 112-BF; Initial	1.00	<1.00	µg/L	
210224Q015	7	Nurse's Office-SK; Initial	1.00	<1.00	µg/L	
210224Q016	8	Nurse's Office Exam Room-SK; Initial	1.00	28.0	µg/L	H
210224Q017	9	Hill Vestibule-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix G

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen canwash closet	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-2	Kitchen 2-bay prep @ A	SK	App	2.06	2/24/2021	-	-	-	None	-	-	-
1001-3	Kitchen 2-bay prep @ B	SK	App	4.51	2/24/2021	-	-	-	None	-	-	-
1001-4	Kitchen handwash @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-5	Kitchen sanitizer station @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-6	Kitchen sanitizer station @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-7	Kitchen sanitizer station	SPY	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-8	Kitchen sanitizer station @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-9	Kitchen pot filler	PF	App	1.26	2/24/2021	-	-	-	None	-	-	-
1001-10	Kitchen handwash @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1001-11	Kitchen island prep	SK	App	1.19	2/24/2021	-	-	-	None	-	-	-
1001-12	Kitchen bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1002-1	Cafeteria	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1002-2	Cafeteria	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1003-1	Custodial office closet	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1003-2	Custodial office bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1004-1	Men faculty bathroom by Room 201	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1005-1	Women faculty bathroom by Room 201	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1006-1	Boys bathroom by Room 201 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1006-2	Boys bathroom by Room 201 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-1	Hallway by Room 201	WF	App	<1.0	2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1008-1	Girls bathroom by Room 201 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1008-2	Girls bathroom by Room 201 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1008-3	Girls bathroom by Room 201 @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1009-1	Room 201	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1009-2	Room 201	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1010-1	Physical Education office bathroom @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1010-2	Physical Education office bathroom @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1011-1	Band & Orchestra office bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1012-1	Room 205	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-2	Room 205	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1013-1	Room 210	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1013-2	Room 210	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1014-1	Room 206	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1014-2	Room 206	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1015-1	Room 209	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1015-2	Room 209	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1016-1	Room 208	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1016-2	Room 208	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1017-1	Room 207	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-2	Room 207	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1018-1	Custodial closet by Room 210	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1019-1	Printer room by Room 210	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1020-1	Girls bathroom by Room 301 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1020-2	Girls bathroom by Room 301 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1020-3	Girls bathroom by Room 301 @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1020-4	Girls bathroom by Room 301 @ D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1020-5	Girls bathroom by Room 301 @ E	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1021-1	Faculty unisex bathroom by Room 301	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1022-1	Hallway by Room 301 (left)	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1022-2	Hallway by Room 301 (right)	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1022-3	Hallway by Room 301 (right)	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1023-1	Custodial closet by Room 301	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1024-1	Boys bathroom by Room 301 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1024-2	Boys bathroom by Room 301 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1024-3	Boys bathroom by Room 301 @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1024-4	Boys bathroom by Room 301 @ D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1024-5	Boys bathroom by Room 301 @ E	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1025-1	Room 301	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1025-2	Room 301	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1026-1	Room 302	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1026-2	Room 302	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1027-1	Room 303	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1027-2	Room 303	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1028-1	Room 304	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1028-1	Room 304	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1029-1	Room 202	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1029-2	Room 202	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1030-1	Faculty room	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1031-1	Room 123	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1031-2	Room 123	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1032-1	Room 124	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1032-2	Room 124	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1033-1	Custodial closet by Room 124	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1034-1	Hallway by Nurse's office	BF	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1035-1	Nurse's office	SK	App	<1.0	2/24/2021	-	-	-	None	-	-	-
1035-2	Nurse's office bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1036-1	Main office kitchenett	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1037-1	Principal's office bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1038-1	Room 101	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1038-2	Room 101	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1039-1	Room 102	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1039-2	Room 102	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1040-1	Hallway by Room 103	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1041-1	Room 103	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1041-2	Room 103	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1042-1	Men faculty bathroom by Room 103	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1043-1	Women faculty bathroom by Room 103 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1043-2	Women faculty bathroom by Room 103 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1044-1	Room 109	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1044-2	Room 109	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1045-1	Room 104	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1045-2	Room 104	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1046-1	Room 105	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1046-2	Room 105	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1047-1	Room 106	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1047-2	Room 106	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1048-1	Room 107	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1048-2	Room 107	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1049-1	Room 110	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1049-2	Room 110	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1050-1	Room 112	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1050-2	Room 112	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1050-3	Room 112 bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1051-1	Room 113	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1051-2	Room 113	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1051-3	Room 113 bathroom	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1052-1	Custodial closet by Room 113	SS	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1053-1	Hallway by Room 113	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1054-1	Women faculty bathroom by Room 113 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1054-2	Women faculty bathroom by Room 113 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1055-1	Boys bathroom by Room 113 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1055-2	Boys bathroom by Room 113 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1056-1	Girls bathroom by Room 114 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1056-2	Girls bathroom by Room 114 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1057-1	Room 114	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1057-2	Room 114	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1057-3	Room 114 bathroom	SK	N/A		2/24/2021	-	-	-	Sign Required	-	-	-
1058-1	Room 115	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1058-2	Room 115	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1058-3	Room 115 bathroom	SK	N/A		2/24/2021	-	-	-	Sign Required	-	-	-
1059-1	Room 111 unit @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1059-2	Room 111 unit @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1059-3	Room 111 unit @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1059-4	Room 111 unit @ D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1059-5	Room 111 unit @ E	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1059-6	Room 111 unit @ F	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1060-1	Room 116	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1060-2	Room 116	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1061-1	Room 117	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1061-2	Room 117	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1062-1	Room 118	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1062-2	Room 118	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1063-1	Room 119	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1063-2	Room 119	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1064-1	Girls bathroom by Room 120 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1064-2	Girls bathroom by Room 120 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1064-3	Girls bathroom by Room 120 @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1065-1	Hallway by Room 120	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1066-1	Boys bathroom by Room 120 @ A	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1066-2	Boys bathroom by Room 120 @ B	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1066-3	Boys bathroom by Room 120 @ C	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1066-4	Boys bathroom by Room 120 @ D	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1067-1	Room 120	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1067-2	Room 120	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1068-1	Room 121	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1068-2	Room 121	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-
1069-1	Room 122	WF	App		2/24/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1069-2	Room 122	SK	N/A		2/24/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210753-17009

February 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Vanderbilt Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 24, 2021. New York Environmental analyzed the samples on February 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Feb 2021
Date Received:	24 Feb 2021
Date Analyzed:	25 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210224Q001	1	Kitchen 2-bay prep @ A-SK; Initial	1.00	2.06	µg/L	
210224Q002	2	Kitchen 2-bay prep @ B-SK; Initial	1.00	4.51	µg/L	
210224Q003	3	Kitchen pot filler-PF; Initial	1.00	1.26	µg/L	
210224Q004	4	Kitchen island prep-SK; Initial	1.00	1.19	µg/L	
210224Q005	5	Cafeteria-BF; Initial	1.00	<1.00	µg/L	
210224Q006	6	Hallway by Room 301 (right)-BF; Initial	1.00	<1.00	µg/L	
210224Q007	7	Hallway by Nurse's office-BF; Initial	1.00	<1.00	µg/L	
210224Q008	8	Nurse's office-SK; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix H

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Basement-Old Laundry Room	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-1	Custodial Office	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-2	Custodial Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-1	Kitchen-Handwash	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-2	Kitchen-2 Sink Unit	SK	App	1.16	2/25/2021	-	-	-	None	-	-	-
1002-3	Kitchen-Single Unit	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-4	Kitchen-2 Bay- Dishwash	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-5	Kitchen-2 Bay- Dishwash	SPY	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-6	Kitchen-Serving Area	SK	App	8.75	2/25/2021	-	-	-	None	-	-	-
1002-7	Kitchen-Ice Cream Serving Area-Single Unit	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-8	Kitchen-Ice Cream Serving Area-Handwash	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-9	Kitchen-Serving Area by Custodial Office	SK	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1002-10	Kitchen Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-11	Kitchen-Pot Filler	PF	App	1.4	2/25/2021	-	-	-	None	-	-	-
1002-12	Kitchen-Island Prep Sink	SK	App	6.96	2/25/2021	-	-	-	None	-	-	-
1003-1	Caeteria	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1003-2	Caeteria	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1004-1	Room 301	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1004-2	Room 301-Trough @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1004-3	Room 301-Trough @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1005-1	Room 302	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1005-2	Room 302-Trough @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1005-3	Room 302-Trough @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1006-1	Room 303	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1006-2	Room 303-Trough @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1006-3	Room 303-Trough @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1007-1	Vestibule by New Gym	WF	App	<1.0	2/25/2021	-	-	-	None		-	-
1008-1	Boy's Locker Room-Coach's Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-2	Boy's Locker Room Custodial Closet	SS	N/A		2/25/2021	-	-	-	None	LOCKED DOOR	-	-
1008-3	Boy's Locker Room Bathroom @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-4	Boy's Locker Room Bathroom @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1009-1	Hallway by Boy's Locker Room	WF	App	6.34	2/25/2021	-	-	-	None		-	-
1009-2	Hallway by Boy's Locker Room	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1010-1	Custodial Closet by Girl's Locker Room	SS	N/A		2/25/2021	-	-	-	None	LOCKED DOOR	-	-
1011-1	Vestibule by Girl's Locker Room	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-1	Girl's Locker Room	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-2	Girl's Locker Room-Coach's Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1012-3	Girl's Locker Room Bathroom @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1012-4	Girl's Locker Room Bathroom @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1013-1	Hallway by Room 301	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1014-1	Boy's Bathroom by Kitchen @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1014-2	Boy's Bathroom by Kitchen @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1015-1	Men's Bathroom by Kitchen	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1016-1	Women's Bathroom by Kitchen	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1017-1	Custodial Closet by Kitchen	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1018-1	Hallway by Cafeteria	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1019-1	Faculty Room Kitchenette	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1020-1	Girl's Bathroom by Faculty Room @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1020-2	Girl's Bathroom by Faculty Room @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1021-1	Library Kitchenette	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1022-1	Girl's Bathroom by Room 101 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1022-2	Girl's Bathroom by Room 101 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1022-3	Girl's Bathroom by Room 101 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1022-4	Girl's Bathroom by Room 101 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1023-1	Boy's Bathroom by Room 101 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1023-2	Boy's Bathroom by Room 101 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1023-3	Boy's Bathroom by Room 101 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1023-4	Boy's Bathroom by Room 101 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1023-5	Boy's Bathroom by Room 101 @E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1024-1	Custodial Closet by Room 101	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1025-1	Hallway by Room 101	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1026-1	Hallway by Room 104	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1027-1	Hallway by Room 127	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1028-1	Men's Bathroom by Elevator	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1029-1	Women's Bathroom by Elevator	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1030-1	Women's Bathroom by Room 401	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-1	Men's Bathroom by Room 401	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-1	Room 401-Teacher's Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-2	Room 401-Pod 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-3	Room 401-Pod 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-4	Room 401-Pod 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-5	Room 401-Pod 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-6	Room 401-Pod 3 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-7	Room 401-Pod 3 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-8	Room 401-Pod 4 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-9	Room 401-Pod 4 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-10	Room 401-Counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-11	Room 401 Prep Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1033-1	Room 402-Teacher's Station	SK	App	62.9	2/25/2021				Additional Sampling Required			
1033-2	Room 402 Prep Room	SK	App	104	2/25/2021				Additional Sampling Required			

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1033-3	Room 402-Counter @A	SK	App	38.4	2/25/2021				Additional Sampling Required			
1033-4	Room 402-Counter @B	SK	App	35.1	2/25/2021				Additional Sampling Required			
1033-5	Room 402-Counter @C	SK	App	58.1	2/25/2021				Additional Sampling Required			
1033-6	Room 402-Counter @D	SK	App	71.4	2/25/2021				Additional Sampling Required			
1033-7	Room 402-Counter @E	SK	App	65.2	2/25/2021				Additional Sampling Required			
1033-8	Room 402-Counter @F	SK	App	65.4	2/25/2021				Additional Sampling Required			
1033-9	Room 402-Counter @G	SK	App	47.9	2/25/2021				Additional Sampling Required			
1034-1	Hallway by Room 403	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1035-1	Room 405-Teacher's Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-2	Room 405-Pod 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-3	Room 405-Pod 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-4	Room 405-Pod 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-5	Room 405-Pod 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-6	Room 405-Pod 3 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-7	Room 405-Pod 3 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-8	Room 405-Pod 4 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-9	Room 405-Pod 4 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-10	Room 405-Pod 5 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-11	Room 405-Pod 5 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-12	Room 405-Pod 6 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1035-13	Room 405-Pod 6 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-14	Room 405-Counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-15	Room 405 Prep Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-1	Room 501-Teacher's Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-2	Room 501-Counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-3	Room 501-Pod 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-4	Room 501-Pod 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-5	Room 501-Pod 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-6	Room 501-Pod 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-7	Room 501-Pod 3 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-8	Room 501-Pod 3 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-9	Room 501-Pod 4 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-10	Room 501-Pod 4 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-11	Room 501-Pod 5 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-12	Room 501-Pod 5 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-13	Room 501-Pod 6 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-14	Room 501-Pod 6 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1036-15	Room 501 Prep Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1037-1	Girl's Bathroom by Room 502 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1037-2	Girl's Bathroom by Room 502 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1037-3	Girl's Bathroom by Room 502 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1037-4	Girl's Bathroom by Room 502 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1038-1	Custodial Closet by Room 502	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1039-1	Boy's Bathroom by Room 502 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1039-2	Boy's Bathroom by Room 502 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1039-3	Boy's Bathroom by Room 502 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1039-4	Boy's Bathroom by Room 502 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1039-5	Boy's Bathroom by Room 502 @E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1040-1	Hallway by Room 502	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1041-1	Room 706-Teacher's Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-2	Room 706-Counter @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-3	Room 706-Counter @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-4	Room 706-Fume Hood	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-5	Room 706-Pod 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-6	Room 706-Pod 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-7	Room 706-Pod 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-8	Room 706-Pod 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-9	Room 706-Pod 3 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-10	Room 706-Pod 3 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-11	Room 706-Pod 4 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1041-12	Room 706-Pod 4 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-13	Room 706-Pod 5 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-14	Room 706-Pod 5 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-15	Room 706-Island @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1041-16	Room 706 Prep Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-1	Room 708-Teacher's Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-2	Room 708-Counter @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-3	Room 708-Counter @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-4	Room 708-Fume Hood	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-5	Room 708-Pod 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-6	Room 708-Pod 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-7	Room 708-Pod 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-8	Room 708-Pod 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-9	Room 708-Pod 3 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-10	Room 708-Pod 3 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-11	Room 708-Pod 4 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-12	Room 708-Pod 4 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-13	Room 708-Pod 5 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-14	Room 708-Pod 5 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1042-15	Room 708-Island @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1042-16	Room 708 Prep Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-1	Room 710-Teacher's Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-2	Room 710-Counter @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-3	Room 710-Counter @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-4	Room 710-Fume Hood	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-5	Room 710-Pod 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-6	Room 710-Pod 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-7	Room 710-Pod 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-8	Room 710-Pod 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-9	Room 710-Pod 3 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-10	Room 710-Pod 3 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-11	Room 710-Pod 4 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-12	Room 710-Pod 4 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-13	Room 710-Pod 5 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-14	Room 710-Pod 5 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-15	Room 710-Island @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1043-16	Room 710 Prep Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1044-1	Boy's Bathroom by Room 710 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1044-2	Boy's Bathroom by Room 710 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1044-3	Boy's Bathroom by Room 710 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1045-1	Girl's Bathroom by Room 710 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1045-2	Girl's Bathroom by Room 710 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1045-3	Girl's Bathroom by Room 710 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1046-1	Room 607-Home Economics-Counter @A	SK	App	4.57	2/25/2021	-	-	-	None	-	-	-
1046-2	Room 607-Home Economics-Counter @B	SK	App	2.12	2/25/2021	-	-	-	None	-	-	-
1047-1	Room 605-Home Economics-Counter @A	SK	App	4.29	2/25/2021	-	-	-	None	-	-	-
1047-2	Room 605-Home Economics-Counter @B	SK	App	9.08	2/25/2021	-	-	-	None	-	-	-
1047-3	Room 605-Home Economics-Counter @B	SPY	App	2.43	2/25/2021	-	-	-	None	-	-	-
1048-1	Hallway by Room 604	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1049-1	Room 604-Art-Left Trough @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1049-2	Room 604-Art-Left Trough @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1049-3	Room 604-Art-Right Trough @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1049-4	Room 604-Art-Right Trough @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-1	Room 603-Teacher's Station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-2	Room 603-Pod 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-3	Room 603-Pod 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-4	Room 603-Pod 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-5	Room 603-Pod 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-6	Room 603-Pod 3 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-7	Room 603-Pod 3 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1050-8	Room 603-Pod 4 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-9	Room 603-Pod 4 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-10	Room 603-Pod 5 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-11	Room 603-Pod 5 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-12	Room 603-Pod 6 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-13	Room 603-Pod 6 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-14	Room 603-Counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1050-15	Room 603 Prep Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1051-1	Room 602-Trough 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1051-2	Room 602-Trough 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1051-3	Room 602-Trough 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1051-4	Room 602-Trough 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1052-1	Room 601-Trough 1 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1052-2	Room 601-Trough 1 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1052-3	Room 601-Trough 2 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1052-4	Room 601-Trough 2 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1053-1	Nurse's Office	SK	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1053-2	Nurse's Office Exam Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1053-3	Nurse's Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1054-1	Custodial Closet by Main Office	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1055-1	Hallway by Main Office-Left	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1055-2	Hallway by Main Office-Right	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1055-3	Hallway by Main Office-Right	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1056-1	Men's Bathroom by Main Office @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1056-2	Men's Bathroom by Main Office @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1056-3	Men's Bathroom by Main Office @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1057-1	Women's Bathroom by Main Office @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1057-2	Women's Bathroom by Main Office @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1057-3	Women's Bathroom by Main Office @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1058-1	Main Office Bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1058-2	Main Office Kitchenette	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2001-1	Hallway by Room 216	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2002-1	Girl's Bathroom by Room 201 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2002-2	Girl's Bathroom by Room 201 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2002-3	Girl's Bathroom by Room 201 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2002-4	Girl's Bathroom by Room 201 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2003-1	Custodial Closet by Room 201	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2004-1	Boy's Bathroom by Room 201 @A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2004-2	Boy's Bathroom by Room 201 @B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2004-3	Boy's Bathroom by Room 201 @C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2004-4	Boy's Bathroom by Room 201 @D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2004-5	Boy's Bathroom by Room 201 @E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2005-1	Hallway by Room 203	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
2006-1	Hallway by Room 204	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2007-1	Women's Bathroom by Room 205	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2008-1	Room 207A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2009-1	Men's Bathroom by Room 207A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2010-1	Hallway by Room 207A	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2011-1	Hallway by Room 208	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2012-1	Hallway by Room 212	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Laboratory Report

NYE Report #: 2210769-17015

February 26, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Candlewood Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 25, 2021. New York Environmental analyzed the samples on February 26, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	25 Feb 2021
Date Received:	25 Feb 2021
Date Analyzed:	26 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210225M001	1	Kitchen-2 Sink Unit-SK; Initial	1.00	1.16	µg/L	
210225M002	2	Kitchen-Serving Area-SK; Initial	1.00	8.75	µg/L	
210225M003	3	Kitchen-Serving Area by Custodial Office-SK; Initial	1.00	<1.00	µg/L	
210225M004	4	Kitchen-Pot Filler-PF; Initial	1.00	1.40	µg/L	
210225M005	5	Kitchen-Island Prep Sink-SK; Initial	1.00	6.96	µg/L	
210225M006	6	Caeteria-BF; Initial	1.00	<1.00	µg/L	
210225M007	7	Vestibule by New Gym-WF; Initial	1.00	<1.00	µg/L	
210225M008	8	Hallway by Boy's Locker Room-WF; Initial	1.00	6.34	µg/L	
210225M009	9	Hallway by Boy's Locker Room-BF; Initial	1.00	<1.00	µg/L	
210225M010	10	Hallway by Room 203-BF; Initial	1.00	<1.00	µg/L	
210225M011	11	Room 402-Teacher's Station-SK; Initial	1.00	62.9	µg/L	E,H
210225M012	12	Room 402 Prep Room-SK; Initial	1.00	104	µg/L	E,H
210225M013	13	Room 402-Counter @A-SK; Initial	1.00	38.4	µg/L	H
210225M014	14	Room 402-Counter @B-SK; Initial	1.00	35.1	µg/L	H
210225M015	15	Room 402-Counter @C-SK; Initial	1.00	58.1	µg/L	E,H
210225M016	16	Room 402-Counter @D-SK; Initial	1.00	71.4	µg/L	E,H
210225M017	17	Room 402-Counter @E-SK; Initial	1.00	65.2	µg/L	E,H
210225M018	18	Room 402-Counter @F-SK; Initial	1.00	65.4	µg/L	E,H
210225M019	19	Room 402-Counter @G-SK; Initial	1.00	47.9	µg/L	H
210225M020	20	Hallway by Room 403-BF; Initial	1.00	<1.00	µg/L	
210225M021	21	Room 607-Home Economics-Counter @A-SK; Initial	1.00	4.57	µg/L	
210225M022	22	Room 607-Home Economics-Counter @B-SK; Initial	1.00	2.12	µg/L	
210225M023	23	Room 605-Home Economics-Counter @A-SK; Initial	1.00	4.29	µg/L	
210225M024	24	Room 605-Home Economics-Counter @B-SK; Initial	1.00	9.08	µg/L	
210225M025	25	Room 605-Home Economics-Counter @B-SPY; Initial	1.00	2.43	µg/L	
210225M026	26	Nurse's Office-SK; Initial	1.00	<1.00	µg/L	

Date Collected:	25 Feb 2021
Date Received:	25 Feb 2021
Date Analyzed:	26 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210225M027	27	Hallway by Main Office-Right-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix I

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Boiler Room	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
0002-1	Custodian basement room bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1001-1	Custodial office kinchenett	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1002-1	Room 117	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1003-1	Custodial closet by Room 117	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1004-1	Hallway nearby Room 117	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1005-1	Room 118 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1005-2	Room 118 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1005-3	Room 118	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1006-1	Room 119 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1006-2	Room 119 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1006-3	Room 119	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1007-1	Room 120	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1007-2	Room 120	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-1	Kitchen handwash @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-2	Kitchen 2-bay prep @ A	SK	App	2.2	2/25/2021	-	-	-	None	-	-	-
1008-3	Kitchen 2-bay prep @ B	SK	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1008-4	Kitchen canwash closet	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-5	Kitchen bathroom @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-6	Kitchen bathroom @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1008-7	Kitchen island prep	SK	App	6.53	2/25/2021	-	-	-	None	-	-	-
1008-8	Kitchen handwash @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-9	Kitchen 1-bay prep	SK	App	2.77	2/25/2021	-	-	-	None	-	-	-
1008-10	Kitchen serving line	SK	App	13	2/25/2021	-	-	-	None	-	-	-
1008-11	Kitchen custodian closet	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-12	Kitchen sanitizer station @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-13	Kitchen sanitizer station @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-14	Kitchen sanitizer station @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1008-15	Kitchen island prep by ovens	SK	App	3.67	2/25/2021	-	-	-	None	-	-	-
1008-16	Kitchen pot filler station @ A	SK	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1008-17	Kitchen pot filler station @ B	SK	App	19	2/25/2021				Additional Sampling Required			
1008-18	Kitchen pot filler station @ C	SK	App	18.2	2/25/2021				Additional Sampling Required			
1008-19	Kitchen island by steam ovens	SK	App	2.57	2/25/2021	-	-	-	None	-	-	-
1009-1	Faculty dining kitchenett	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1010-1	Room 122 - Band Room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1011-1	Hallway by Auditorium	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-1	Men faculty bathroom by Auditorium @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1012-2	Men faculty bathroom by Auditorium @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1013-1	Women faculty bathroom by Auditorium @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1013-2	Women faculty bathroom by Auditorium @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1014-1	Hallway by Auditorium	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1015-1	Main office hallway women bathroom @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1015-2	Main office hallway women bathroom @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1016-1	Main office hallway men bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1017-1	Principal's office bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1018-1	Main office kinchenett	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1018-2	Main office kinchenett	SPY	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1019-1	Custodial closet by Room 109A	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1020-1	Hallway by Room 109A	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-1	Hallway by Room 142 (left)	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-2	Hallway by Room 142 (right)	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-3	Hallway by Room 142 (right)	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1022-1	Women faculty bathroom by Room 142 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1022-2	Women faculty bathroom by Room 142 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1022-3	Women faculty bathroom by Room 142 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1023-1	Custodial closet by Room 142	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1024-1	Girls locker room	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1024-2	Girls locker room bathroom @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1024-3	Girls locker room bathroom @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1024-4	Girls locker room bathroom @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1025-1	Custodial closet by The Annex	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1026-1	Men faculty bathroom by The Annex	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1027-1	The Annex bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-1	Room 114 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-2	Room 114 counter @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-3	Room 114 counter @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-4	Room 114 counter @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-5	Room 114 counter @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-6	Room 114 counter @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1028-7	Room 114 counter @ F	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1029-1	Prep room 114/116	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1030-1	Gymnasium foyer - Girls locker room side	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1031-1	Girls bathroom by Gymnasium @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-2	Girls bathroom by Gymnasium @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-3	Girls bathroom by Gymnasium @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-4	Girls bathroom by Gymnasium @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-5	Girls bathroom by Gymnasium @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-6	Girls bathroom by Gymnasium @ F	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1031-7	Girls bathroom by Gymnasium @ G	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-1	Boys bathroom by Gymnasium @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1032-2	Boys bathroom by Gymnasium @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-3	Boys bathroom by Gymnasium @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-4	Boys bathroom by Gymnasium @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-5	Boys bathroom by Gymnasium @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-6	Boys bathroom by Gymnasium @ F	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1032-7	Boys bathroom by Gymnasium @ G	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1033-1	Nurse's office	SK	App	<1.0	2/25/2021	-	-	-	None	-	-	-
1033-2	Nurse's office storage	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1033-3	Nurse's office bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1034-1	Gymnasium foyer - Boys locker room side	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1035-1	Boys locker room bathroom @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-2	Boys locker room bathroom @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
1035-3	Boys locker room bathroom @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2001-1	Room 223 - Station #1	SK	App	10.7	2/25/2021	-	-	-	None	-	-	-
2001-2	Room 223 - Station #2	SK	App	16.9	2/25/2021				Additional Sampling Required			
2001-3	Room 223 - Station #3	SK	App	34.9	2/25/2021				Additional Sampling Required			
2001-4	Room 223 - Station #4	SK	App	108	2/25/2021				Additional Sampling Required			
2001-5	Room 223 - Station #5	SK	App	17.6	2/25/2021				Additional Sampling Required			
2001-6	Room 223 - Station #6	SK	App	4.65	2/25/2021	-	-	-	None	-	-	-
2002-1	Prep room 223/225 (laundry)	SK	App	62.6	2/25/2021				Additional Sampling Required			

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-1	Room 225 - Station #1	SK	App	13.7	2/25/2021	-	-	-	None	-	-	-
2003-2	Room 225 - Station #2	SK	App	34.1	2/25/2021				Additional Sampling Required			
2003-3	Room 225 - Station #3	SK	App	3.11	2/25/2021	-	-	-	None	-	-	-
2003-4	Room 225 - Station #4	SK	App	8.61	2/25/2021	-	-	-	None	-	-	-
2004-1	Room 226 - Station #1	SK	App	6.56	2/25/2021	-	-	-	None	-	-	-
2004-2	Room 226 - Station #2	SK	App	4.33	2/25/2021	-	-	-	None	-	-	-
2005-1	Room 218 counter @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2005-2	Room 218 counter @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2005-3	Room 218 counter @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2005-4	Room 218 counter @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2005-5	Room 218 counter @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2006-1	Room 231 unit @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2006-2	Room 231 unit @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2006-3	Room 231 unit @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2006-4	Room 231 unit @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2006-5	Room 231 unit @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2006-6	Room 231 unit @ F	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2007-1	Room 232 counter @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2007-2	Room 232 counter @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2007-3	Room 232 counter @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2007-4	Room 232 counter @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2007-5	Room 232 counter @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2007-6	Room 232 counter @ F	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2008-1	Women faculty bathroom by Room 232	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2009-1	Hallway by Room 220	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2010-1	Men faculty bathroom by Room 220 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2010-2	Men faculty bathroom by Room 220 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2011-1	Custodial closet by Projection Room	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2012-1	Women faculty bathroom by Library @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2012-2	Women faculty bathroom by Library @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2013-1	Hallway by Library	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
2014-1	Library work room	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2015-1	Custodial closet by Room 207A	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2016-1	Hallway by Room 207A	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2017-1	Room 208 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-2	Room 208 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-3	Room 208 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-4	Room 208 - Table #1 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-5	Room 208 - Table #1 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-6	Room 208 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2017-7	Room 208 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-8	Room 208 - Table #2 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-9	Room 208 - Table #2 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-10	Room 208 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-11	Room 208 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-12	Room 208 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-13	Room 208 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-14	Room 208 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-15	Room 208 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2017-16	Room 208 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-1	Room 210 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-2	Room 210 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-3	Room 210 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-4	Room 210 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	CAPPED	-	-
2018-5	Room 210 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-6	Room 210 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-7	Room 210 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-8	Room 210 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-9	Room 210 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-10	Room 210 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-11	Room 210 - Table #4 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-12	Room 210 - Table #4 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-13	Room 210 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-14	Room 210 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-15	Room 210 - Table #5 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2018-16	Room 210 - Table #5 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-1	Room 209 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-2	Room 209 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-3	Room 209 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-4	Room 209 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-5	Room 209 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-6	Room 209 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-7	Room 209 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-8	Room 209 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-9	Room 209 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-10	Room 209 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-11	Room 209 - Table #4 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-12	Room 209 - Table #4 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-13	Room 209 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-14	Room 209 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2019-15	Room 209 - Table #5 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2019-16	Room 209 - Table #5 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-1	Room 211 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-2	Room 211 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-3	Room 211 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-4	Room 211 - Table #1 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-5	Room 211 - Table #1 @ D	SK	N/A		2/25/2021	-	-	-	None	CAPPED	-	-
2020-6	Room 211 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-7	Room 211 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-8	Room 211 - Table #2 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-9	Room 211 - Table #2 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-10	Room 211 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-11	Room 211 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-12	Room 211 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-13	Room 211 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-14	Room 211 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-15	Room 211 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2020-16	Room 211 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2021-1	Hallway by Room 242 (left)	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2021-2	Hallway by Room 242 (right)	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2021-3	Hallway by Room 242 (right)	BF	App	<1.0	2/25/2021	-	-	-	None	-	-	-
2022-1	Boys bathroom by Room 242 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2022-2	Boys bathroom by Room 242 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2022-3	Boys bathroom by Room 242 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2022-4	Boys bathroom by Room 242 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2023-1	Custodial closet by Room 242	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2024-1	2nd floor Greenhouse	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-1	Room 212 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-2	Room 212 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-3	Room 212 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-4	Room 212 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-5	Room 212 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-6	Room 212 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-7	Room 212 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-8	Room 212 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-9	Room 212 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-10	Room 212 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-11	Room 212 - Table #4 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-12	Room 212 - Table #4 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-13	Room 212 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2025-14	Room 212 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-15	Room 212 - Table #5 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2025-16	Room 212 - Table #5 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-1	Room 213 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-2	Room 213 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-3	Room 213 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-4	Room 213 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-5	Room 213 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-6	Room 213 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-7	Room 213 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-8	Room 213 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-9	Room 213 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-10	Room 213 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-11	Room 213 - Table #4 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-12	Room 213 - Table #4 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-13	Room 213 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-14	Room 213 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-15	Room 213 - Table #5 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2026-16	Room 213 - Table #5 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2027-1	Boys bathroom by Room 214 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2027-2	Boys bathroom by Room 214 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2027-3	Boys bathroom by Room 214 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2027-4	Boys bathroom by Room 214 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2027-5	Boys bathroom by Room 214 @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2027-6	Boys bathroom by Room 214 @ F	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2027-7	Boys bathroom by Room 214 @ G	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2028-1	Custodial closet by Room 214	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-1	Room 214 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-2	Room 214 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-3	Room 214 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-4	Room 214 - Table #1 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-5	Room 214 - Table #1 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-6	Room 214 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-7	Room 214 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-8	Room 214 - Table #2 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-9	Room 214 - Table #2 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-10	Room 214 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-11	Room 214 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-12	Room 214 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-13	Room 214 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2029-14	Room 214 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-15	Room 214 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2029-16	Room 214 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-1	Room 216 teacher's station	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-2	Room 216 counter	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-3	Room 216 - Table #1 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-4	Room 216 - Table #1 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-5	Room 216 - Table #2 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-6	Room 216 - Table #2 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-7	Room 216 - Table #3 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-8	Room 216 - Table #3 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-9	Room 216 - Table #4 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-10	Room 216 - Table #4 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-11	Room 216 - Table #4 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-12	Room 216 - Table #4 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-13	Room 216 - Table #5 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-14	Room 216 - Table #5 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-15	Room 216 - Table #5 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2030-16	Room 216 - Table #5 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2031-1	Girls bathroom by Room 216 @ A	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2031-2	Girls bathroom by Room 216 @ B	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2031-3	Girls bathroom by Room 216 @ C	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2031-4	Girls bathroom by Room 216 @ D	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2031-5	Girls bathroom by Room 216 @ E	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2031-6	Girls bathroom by Room 216 @ F	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2031-7	Girls bathroom by Room 216 @ G	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2032-1	Hallway by Room 216	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2033-1	Men faculty bathroom by Room 216	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2034-1	Science Department bathroom	SK	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2035-1	Custodial closet by Room 217D	SS	N/A		2/25/2021	-	-	-	None	SIGN	-	-
2036-1	Hallway by Room 217D	WF	App		2/25/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Laboratory Report

NYE Report #: 2210771-17017

February 26, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: West Hollow Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 25, 2021. New York Environmental analyzed the samples on February 26, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	25 Feb 2021
Date Received:	25 Feb 2021
Date Analyzed:	26 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210225M036	1	Kitchen 2-bay prep @ A-SK; Initial	1.00	2.20	µg/L	
210225M037	2	Kitchen 2-bay prep @ B-SK; Initial	1.00	<1.00	µg/L	
210225M038	3	Kitchen island prep-SK; Initial	1.00	6.53	µg/L	
210225M039	4	Kitchen 1-bay prep-SK; Initial	1.00	2.77	µg/L	
210225M040	5	Kitchen serving line-SK; Initial	1.00	13.0	µg/L	
210225M041	6	Kitchen island prep by ovens-SK; Initial	1.00	3.67	µg/L	
210225M042	7	Kitchen pot filler station @ A-SK; Initial	1.00	<1.00	µg/L	
210225M043	8	Kitchen pot filler station @ B-SK; Initial	1.00	19.0	µg/L	H
210225M044	9	Kitchen pot filler station @ C-SK; Initial	1.00	18.2	µg/L	H
210225M045	10	Kitchen island by steam ovens-SK; Initial	1.00	2.57	µg/L	
210225M046	11	Hallway by Auditorium-BF; Initial	1.00	<1.00	µg/L	
210225M047	12	Hallway by Room 142 (right)-BF; Initial	1.00	<1.00	µg/L	
210225M048	13	Gymnasium foyer - Girls locker room side-BF; Initial	1.00	<1.00	µg/L	
210225M049	14	Nurse's office-SK; Initial	1.00	<1.00	µg/L	
210225M050	15	Room 223 - Station #1-SK; Initial	1.00	10.7	µg/L	
210225M051	16	Room 223 - Station #2-SK; Initial	1.00	16.9	µg/L	H
210225M052	17	Room 223 - Station #3-SK; Initial	1.00	34.9	µg/L	H
210225M053	18	Room 223 - Station #4-SK; Initial	1.00	108	µg/L	E,H
210225M054	19	Room 223 - Station #5-SK; Initial	1.00	17.6	µg/L	H
210225M055	20	Room 223 - Station #6-SK; Initial	1.00	4.65	µg/L	
210225M056	21	Prep room 223/225 (laundry)-SK; Initial	1.00	62.6	µg/L	E,H
210225M057	22	Room 225 - Station #1-SK; Initial	1.00	13.7	µg/L	
210225M058	23	Room 225 - Station #2-SK; Initial	1.00	34.1	µg/L	H
210225M059	24	Room 225 - Station #3-SK; Initial	1.00	3.11	µg/L	
210225M060	25	Room 225 - Station #4-SK; Initial	1.00	8.61	µg/L	
210225M061	26	Room 226 - Station #1-SK; Initial	1.00	6.56	µg/L	

Date Collected:	25 Feb 2021
Date Received:	25 Feb 2021
Date Analyzed:	26 Feb 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210225M062	27	Room 226 - Station #2-SK; Initial	1.00	4.33	µg/L	
210225M063	28	Hallway by Library-BF; Initial	1.00	<1.00	µg/L	
210225M064	29	Hallway by Room 242 (right)-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix J

Half Hollow Hills CSD
Half Hollow Hills High School East

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Hallway By Room 908	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
0002-1	Women's Bathroom by Room 906 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0002-2	Women's Bathroom by Room 906 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0002-3	Women's Bathroom by Room 906 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0002-4	Women's Bathroom by Room 906 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0003-1	Custodial Closet by Room 906	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0004-1	Men's Bathroom by Room 906 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0004-2	Men's Bathroom by Room 906 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0004-3	Men's Bathroom by Room 906 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0005-1	Hallway by Room 901	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
0006-1	Girl's Locker Room Exit Vestibule	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
0006-2	Girl's Coach's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0006-3	Girl's Locker Room Bathroom @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0006-4	Girl's Locker Room Bathroom @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0006-5	Girl's Locker Room Bathroom @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0006-6	Girl's Locker Room Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0007-1	Boy's Coach's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0007-2	Boy's Locker Room	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
0007-3	Boy's Locker Room Bathroom @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0007-4	Boy's Locker Room Bathroom @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Half Hollow Hills CSD
Half Hollow Hills High School East

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0007-5	Boy's Locker Room Bathroom @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0007-6	Boy's Locker Room Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0008-1	Boy's Team Room Bathroom @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0008-2	Boy's Team Room Bathroom @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0008-3	Boy's Team Room	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
0008-4	Boy's Team Room Coach's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-1	Cafeteria B	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1001-2	Cafeteria B	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1002-1	Kitchen-Serving Area-Handwash-Left	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-2	Kitchen-Handwash-Left	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-3	Kitchen-Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-4	Kitchen-2 Bay Unit	SK	App	1.38	2/26/2021	-	-	-	None	-	-	-
1002-5	Kitchen-2 Bay Unit	SPY	App	1.42	2/26/2021	-	-	-	None	-	-	-
1002-6	Kitchen Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-7	Kitchen-Handwash-Right	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-8	Kitchen-Pot Filler	PF	App	4	2/26/2021	-	-	-	None	-	-	-
1002-9	Kitchen-3 Bay Unit-Left	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-10	Kitchen-3 Bay Unit-Right	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-11	Kitchen-3 Bay Unit	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-12	Kitchen-Prep Island	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1003-1	Faculty Room Cafeteria-Serving Line	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1003-2	Faculty Room-Cafeteria	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1004-1	Cafeteria A	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1004-2	Cafeteria A	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1004-3	Cafeteria A-Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-1	Boy's Bathroom by Cafeteria A @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-2	Boy's Bathroom by Cafeteria A @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-3	Boy's Bathroom by Cafeteria A @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1006-1	Men's Faculty Bathroom by Cafeteria A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1007-1	Custodial Closet by Cafeteria A	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-1	Girl's Bathroom by Cafeteria A @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-2	Girl's Bathroom by Cafeteria A @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-3	Girl's Bathroom by Cafeteria A @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1009-1	Women's Faculty Bathroom by Cafeteria A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1010-1	Fencing Bathroom by Cafeteria A @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1010-2	Fencing Bathroom by Cafeteria A @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1011-1	Hallway by Room 812	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-1	Room 812-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-2	Room 812-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-3	Room 812-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-4	Room 812-Island 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-5	Room 812-Island 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-6	Room 812-Island 1 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-7	Room 812-Island 1 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-8	Room 812-Island 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-9	Room 812-Island 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-10	Room 812-Island 2 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-11	Room 812-Island 2 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1013-1	Hallway by Room 707	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1014-1	Custodial Closet by Room 711	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1015-1	Faculty Men's Bathroom @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1015-2	Faculty Men's Bathroom @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1015-3	Faculty Men's Bathroom @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1016-1	Hallway by Room 711	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1017-1	Room 711	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1018-1	Staff Bathroom by Room 715 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1018-2	Staff Bathroom by Room 715 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1018-3	Staff Bathroom by Room 715 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1019-1	Loading Dock Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1020-1	Hallway by Room 911	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1021-1	Boy's Bathroom by Room 916 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1021-2	Boy's Bathroom by Room 916 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1021-3	Boy's Bathroom by Room 916 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1022-1	Custodial Closet by Room 916	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-1	Girl's Bathroom by Room 916 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-2	Girl's Bathroom by Room 916 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-3	Girl's Bathroom by Room 916 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-4	Girl's Bathroom by Room 916 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1024-1	Hallway by Room 917	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1025-1	Women's Bathroom by Guidance Office @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1025-2	Women's Bathroom by Guidance Office @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1025-3	Women's Bathroom by Guidance Office @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1026-1	Hallway by Room 717	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1027-1	Men's Bathroom by Room 717 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1027-2	Men's Bathroom by Room 717 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1027-3	Men's Bathroom by Room 717 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1028-1	Nurse's Office	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1028-2	Nurse's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1029-1	Principal's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1029-2	Main Office Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Half Hollow Hills CSD
Half Hollow Hills High School East

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1030-1	Men's Bathroom by Mail Room @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1030-2	Men's Bathroom by Mail Room @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1030-3	Men's Bathroom by Mail Room @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1031-1	Hallway by Mail Room	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1031-2	Hallway by Mail Room	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1032-1	Girl's Bathroom by Room 701 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1032-2	Girl's Bathroom by Room 701 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1033-1	Hallway by Room 703	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1034-1	Room 703	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1035-1	Girl's Bathroom by Room 611	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1036-1	Custodial Closet by Reoom 611	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1037-1	Boy's Bathroom by Room 611	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1038-1	Hallway by Room 609	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1039-1	Hallway by Room 603	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1040-1	Women's Bathroom by Room 603	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1041-1	Men's Bathroom by Room 603	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1042-1	Room 605 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1042-2	Room 605 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1042-3	Room 605 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1043-1	Women's Bathroom by Auditorium/Lobby @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Half Hollow Hills CSD
Half Hollow Hills High School East

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1043-2	Women's Bathroom by Auditorium/Lobby @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1043-3	Women's Bathroom by Auditorium/Lobby @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1043-4	Women's Bathroom by Auditorium/Lobby @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1043-5	Women's Bathroom by Auditorium/Lobby @E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1044-1	Hallway by Women's Bathroom	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1045-1	Hallway by Men's Bathroom	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1046-1	Men's Bathroom by Auditorium/Lobby @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1046-2	Men's Bathroom by Auditorium/Lobby @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1046-3	Men's Bathroom by Auditorium/Lobby @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1046-4	Men's Bathroom-Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1047-1	Hallway by Main Gym-Girl's Side	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1048-1	Main Gym-Girl's Side	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1048-2	Main Gym-Girl's Side	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1049-1	Trainer's Office	IM	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1049-2	Trainer's Office	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1050-1	Main Gym-Boy's Side	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1051-1	Hallway by Main Gym-Boy's Side	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1052-1	Boy's Bathroom by Room 211 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1052-2	Boy's Bathroom by Room 211 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1052-3	Boy's Bathroom by Room 211 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1052-4	Boy's Bathroom by Room 211 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1052-5	Boy's Bathroom by Room 211 @E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1053-1	Custodial Closet by Room 211	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1054-1	Girl's Bathroom by Room 211 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1054-2	Girl's Bathroom by Room 211 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1054-3	Girl's Bathroom by Room 211 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1054-4	Girl's Bathroom by Room 211 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1054-5	Girl's Bathroom by Room 211 @E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1055-1	Room 208	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1056-1	Room 204-Counter @A	SK	App	2.22	2/26/2021	-	-	-	None	-	-	-
1056-2	Room 204-Counter @A	SPY	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-3	Room 204-Counter @B	SK	App	2.77	2/26/2021	-	-	-	None	-	-	-
1056-4	Room 204-Counter @B	SPY	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-5	Room 204-Counter @C	SK	App	2.14	2/26/2021	-	-	-	None	-	-	-
1056-6	Room 204-Counter @C	SPY	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-7	Room 204-Counter @D	SK	App	3.52	2/26/2021	-	-	-	None	-	-	-
1056-8	Room 204-Counter @D	SPY	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-9	Room 204-Counter @E	SK	App	7.63	2/26/2021	-	-	-	None	-	-	-
1056-10	Room 204-Counter @E	SPY	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1056-11	Room 204-Counter @F	SK	App	6.04	2/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1056-12	Room 204-Counter @F	SPY	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1057-1	Room 202	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1058-1	Hallway by Room 105	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1059-1	Room 105	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1060-1	Library Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1061-1	Women's Bathroom by Lecture Hall	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1062-1	Hallway by Lecture Hall	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1062-2	Hallway by Lecture Hall	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1063-1	Men's Bathroom by Lecture Hall	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1064-1	East Wing Office Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1064-2	Assistant Principal's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1065-1	Women's Bathroom by East Office	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1066-1	Hallway by East Office	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1067-1	Men's Bathroom by East Office	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1068-1	East Nurse's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1068-2	East Nurse's Office	IM	App	6.83	2/26/2021	-	-	-	None	-	-	-
1068-3	East Nurse's Office	SK	App	189	2/26/2021				Additional Sampling Required			
1068-4	East Nurse's Office-Exam Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1069-1	IPC Girl's Bathroom by Weight Room @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1069-2	IPC Girl's Bathroom by Weight Room @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Half Hollow Hills CSD
Half Hollow Hills High School East

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1070-1	Custodial Closet by Weight Room	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1071-1	IPC Boy's Bathroom by Weight Room @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1071-2	IPC Boy's Bathroom by Weight Room @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1072-1	Room 555-2 Bay Unit	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1073-1	Custodial Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1074-1	Room 554-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1074-2	Room 554-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1075-1	Room 556-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1075-2	Room 556-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1076-1	District Print Room-Trough @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1076-2	District Print Room-Trough @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1076-3	District Print Room-Trough @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1077-1	Weight Room	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1077-2	Weight Room	BF	App	8.15	2/26/2021	-	-	-	None	-	-	-
1078-1	Hallway by Room 544	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1078-2	Hallway by Room 544	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1079-1	Boy's East Gym Locker Room Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1079-2	Boy's East Gym Coach's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1080-1	Men's Bathroom by East Gym	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1081-1	Custodial Closet by East Gym	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1082-1	Women's Bathroom by East Gym @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1082-2	Women's Bathroom by East Gym @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1083-1	Girl's East Gym Coach's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1083-2	Girl's East Gym Locker Room	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1083-3	Girl's East Gym Locker Room Bathroom @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1083-4	Girl's East Gym Locker Room Bathroom @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1084-1	Room 543	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1084-2	Room 543-Dark Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1085-1	Room 541-Left @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1085-2	Room 541-Left @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1085-3	Room 541-Left @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1085-4	Room 541-Right @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1085-5	Room 541-Right @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1085-6	Room 541-Right @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-1	Room 406-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-2	Room 406-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-3	Room 406-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-4	Room 406-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-5	Room 406-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-6	Room 406-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1086-7	Room 406-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-8	Room 406-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-9	Room 406-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-10	Room 406-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-11	Room 406-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-12	Room 406-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-13	Room 406-Pod 6 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-14	Room 406-Pod 6 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-15	Room 406-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-16	Room 406-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-17	Room 406-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-18	Room 406-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-19	Room 406-Prep Room @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1086-20	Room 406-Prep Room @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-1	Room 408-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-2	Room 408-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-3	Room 408-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-4	Room 408-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-5	Room 408-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-6	Room 408-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1087-7	Room 408-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-8	Room 408-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-9	Room 408-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-10	Room 408-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-11	Room 408-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-12	Room 408-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-13	Room 408-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-14	Room 408-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-15	Room 408-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-16	Room 408-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-17	Room 408-Pod 6 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1087-18	Room 408-Pod 6 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-1	Room 407-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-2	Room 407-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-3	Room 407-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-4	Room 407-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-5	Room 407-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-6	Room 407-Counter @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-7	Room 407-Counter @E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-8	Room 407-Counter @F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Half Hollow Hills CSD
Half Hollow Hills High School East

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1088-9	Room 407-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-10	Room 407-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-11	Room 407-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-12	Room 407-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-13	Room 407-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-14	Room 407-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-15	Room 407-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-16	Room 407-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-17	Room 407-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-18	Room 407-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1088-19	Room 407-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-1	Room 405-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-2	Room 405-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-3	Room 405-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-4	Room 405-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-5	Room 405-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-6	Room 405-Counter @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-7	Room 405-Counter @E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-8	Room 405-Counter @F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-9	Room 405-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1089-10	Room 405-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-11	Room 405-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-12	Room 405-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-13	Room 405-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-14	Room 405-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-15	Room 405-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-16	Room 405-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-17	Room 405-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-18	Room 405-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-19	Room 405-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-20	Room 405-Prep Room @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-21	Room 405-Prep Room @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-22	Room 405-Prep Room @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1089-23	Room 405-Prep Room @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1090-1	Boy's Bathroom by Room 404 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1090-2	Boy's Bathroom by Room 404 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1090-3	Boy's Bathroom by Room 404 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1090-4	Boy's Bathroom by Room 404 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1091-1	Custodial Closet by Room 404	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1092-1	Hallway by Room 404	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1093-1	Girl's Bathroom by Room 404 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1093-2	Girl's Bathroom by Room 404 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1093-3	Girl's Bathroom by Room 404 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1093-4	Girl's Bathroom by Room 404 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1094-1	Faculty Room-Women's Bathroom @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1094-2	Faculty Room-Women's Bathroom @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1094-3	Faculty Room-Women's Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1094-4	Faculty Room-Men's Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1094-5	Faculty Room-Men's Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2001-1	Copy Room Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2002-1	Women's Bathroom by Room 721	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2003-1	Men's Bathroom by Room 721	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2004-1	Girl's Bathroom by Room 721 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2004-2	Girl's Bathroom by Room 721 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2005-1	Hallway by Room 721	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
2006-1	Room 723-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2006-2	Room 723-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2006-3	Room 723-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2006-4	Room 723-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2006-5	Room 723-Counter @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2007-1	Room 725-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-2	Room 725-Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-3	Room 725-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-4	Room 725-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-5	Room 725-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-6	Room 725-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-7	Room 725-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-8	Room 725-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-9	Room 725-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-10	Room 725-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-11	Room 725-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-12	Room 725-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-13	Room 725-Island @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-1	Room 727-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-2	Room 727-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-3	Room 727-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-4	Room 727-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-5	Room 727-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-6	Room 727-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-7	Room 727-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-8	Room 727-Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2009-1	Hallway by Room 729	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2010-1	Room 729-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2010-2	Room 729-Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2010-3	Room 729-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2010-4	Room 729-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2010-5	Room 729-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2010-6	Room 729-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2010-7	Room 729-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-1	Room 731-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-2	Room 731-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-3	Room 731-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-4	Room 731-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-5	Room 731-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-6	Room 731-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-7	Room 731-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-8	Room 731-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-9	Room 731-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-10	Room 731-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-11	Room 731-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2011-12	Room 731-Pod 3 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-13	Room 731-Pod 3 @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-14	Room 731-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-15	Room 731-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-16	Room 731-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-17	Room 731-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-18	Room 731-Prep Room @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-19	Room 731-Prep Room @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2012-1	Custodial Closet by Room 731	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-1	Room 733-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-2	Room 733-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-3	Room 733-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-4	Room 733-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-5	Room 733-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-6	Room 733-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-7	Room 733-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-8	Room 733-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-9	Room 733-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-10	Room 733-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-11	Room 733-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2013-12	Room 733-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-13	Room 733-Pod 6 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-14	Room 733-Pod 6 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-15	Room 733-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-16	Room 733-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-17	Room 733-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-18	Room 733-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2014-1	Boy's Bathroom by Room 733 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2014-2	Boy's Bathroom by Room 733 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2014-3	Boy's Bathroom by Room 733 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-1	Hallway by Room 733	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2016-1	Room 735-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-2	Room 735-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-3	Room 735-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-4	Room 735-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-5	Room 735-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-6	Room 735-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-7	Room 735-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-8	Room 735-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-9	Room 735-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2016-10	Room 735-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-11	Room 735-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-12	Room 735-Island 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-13	Room 735-Island 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-14	Room 735-Island 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-15	Room 735-Island 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-16	Room 735-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-17	Room 735-Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-18	Room 735-Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-1	Girl's Bathroom by Planetarium @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-2	Girl's Bathroom by Planetarium @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-3	Girl's Bathroom by Planetarium @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-1	Planetarium Office	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2019-1	Hallway by Room 739	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2020-1	Room 739-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-2	Room 739-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-3	Room 739-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-4	Room 739-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-1	Room 741-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-2	Room 741-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2021-3	Room 741-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-4	Room 741-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-5	Room 741-Counter @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-6	Room 741-Counter @E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-7	Room 741-Counter @F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-8	Room 741-Prep	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-1	Room 743-Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-2	Room 743-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-3	Room 743-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-4	Room 743-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-5	Room 743-Counter @D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-6	Room 743-Counter @E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-7	Room 743-Counter @F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-8	Room 743-Counter @G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2023-1	Hallway by Room 742	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2024-1	Room 745-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-2	Room 745-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-3	Room 745-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-4	Room 745-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-5	Room 745-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Half Hollow Hills CSD
Half Hollow Hills High School East

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2024-6	Room 745-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-7	Room 745-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-8	Room 745-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-9	Room 745-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-10	Room 745-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-11	Room 745-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-12	Room 745-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-13	Room 745-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-14	Room 745-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-15	Room 745-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-16	Room 745-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-17	Room 745-Pod 6 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-18	Room 745-Pod 6 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-19	Room 745-Pod 7 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-20	Room 745-Pod 7 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-21	Room 745-Prep Room @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-22	Room 745-Prep Room @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2025-1	Custodial Closet by Room 746	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-1	Boy's Bathroom by Room 747 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-2	Boy's Bathroom by Room 747 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2026-3	Boy's Bathroom by Room 747 @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-1	Hallway by Room 747	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2028-1	Room 747-Teacher's Station @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-2	Room 747-Teacher's Station @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-3	Room 747-Pod 1 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-4	Room 747-Pod 1 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-5	Room 747-Pod 2 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-6	Room 747-Pod 2 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-7	Room 747-Pod 3 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-8	Room 747-Pod 3 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-9	Room 747-Pod 4 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-10	Room 747-Pod 4 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-11	Room 747-Pod 5 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-12	Room 747-Pod 5 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-13	Room 747-Pod 6 @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-14	Room 747-Pod 6 @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-15	Room 747-Fume Hood	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-16	Room 747-Counter @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-17	Room 747-Counter @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-18	Room 747-Counter @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2029-1	Mezzanine Balcony Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210783-17022

March 1, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Half Hollow Hills High School East

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 26, 2021. New York Environmental analyzed the samples on March 01, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	26 Feb 2021
Date Received:	26 Feb 2021
Date Analyzed:	01 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210226J001	1	Cafeteria B-BF; Initial	1.00	<1.00	µg/L	
210226J002	2	Kitchen-2 Bay Unit-SK; Initial	1.00	1.38	µg/L	
210226J003	3	Kitchen-2 Bay Unit-SPY; Initial	1.00	1.42	µg/L	
210226J004	4	Kitchen-Pot Filler-PF; Initial	1.00	4.00	µg/L	
210226J005	5	Cafeteria A-BF; Initial	1.00	<1.00	µg/L	
210226J006	6	Hallway by Mail Room-BF; Initial	1.00	<1.00	µg/L	
210226J007	7	Hallway by Room 721-BF; Initial	1.00	<1.00	µg/L	
210226J008	8	Hallway by Room 609-BF; Initial	1.00	<1.00	µg/L	
210226J009	9	Main Gym-Girl's Side-BF; Initial	1.00	<1.00	µg/L	
210226J010	10	Boy's Locker Room-BF; Initial	1.00	<1.00	µg/L	
210226J011	11	Room 204-Counter @A-SK; Initial	1.00	2.22	µg/L	
210226J012	12	Room 204-Counter @B-SK; Initial	1.00	2.77	µg/L	
210226J013	13	Room 204-Counter @C-SK; Initial	1.00	2.14	µg/L	
210226J014	14	Room 204-Counter @D-SK; Initial	1.00	3.52	µg/L	
210226J015	15	Room 204-Counter @E-SK; Initial	1.00	7.63	µg/L	
210226J016	16	Room 204-Counter @F-SK; Initial	1.00	6.04	µg/L	
210226J017	17	Hallway by Lecture Hall-BF; Initial	1.00	<1.00	µg/L	
210226J018	18	East Nurse's Office-IM; Initial	1.00	6.83	µg/L	
210226J019	19	East Nurse's Office-SK; Initial	1.00	189	µg/L	E,H
210226J020	20	Weight Room-BF; Initial	1.00	8.15	µg/L	
210226J021	21	Hallway by Room 544-BF; Initial	1.00	<1.00	µg/L	
210226J022	22	Trainer's Office-IM; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix K

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash by Slicer	SK	N/A		2/26/2021	-	-	-	Sign Required	-	-	-
1001-2	Kitchen Prep by Slicer	SK	App	2.24	2/26/2021	-	-	-	None	-	-	-
1001-3	Kitchen Prep by Slicer	SPY	App	1.35	2/26/2021	-	-	-	None	-	-	-
1001-4	Kitchen Handwash by Dishwash Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-5	Kitchen Dishwash @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-6	Kitchen Dishwash @ A	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-7	Kitchen Dishwash @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-8	Kitchen Pot Filler	PF	App	12.4	2/26/2021	-	-	-	None	-	-	-
1001-9	Kitchen Prep by Pot Filler	SK	App	2.99	2/26/2021	-	-	-	None	-	-	-
1001-10	Serving Line Handwash	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-1	Cafeteria South	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1002-2	Cafeteria South	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1003-1	Men's Bathroom by Cafeteria South (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1003-2	Men's Bathroom by Cafeteria South (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1004-1	Home Economics Room 151 Laundry Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1004-2	Home Economics Room 151 Station 1	SK	App	1.4	2/26/2021	-	-	-	None	-	-	-
1004-3	Home Economics Room 151 Station 2	SK	App	1.52	2/26/2021	-	-	-	None	-	-	-
1004-4	Home Economics Room 151 Station 3	SK	App	4.66	2/26/2021	-	-	-	None	-	-	-
1004-5	Home Economics Room 151 Station 4	SK	App	43.4	2/26/2021				Additional Sampling Required			
1004-6	Home Economics Room 151 Back Office (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1004-7	Home Economics Room 151 Back Office (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-1	Women's Bathroom by Cafeteria South (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-2	Women's Bathroom by Cafeteria South (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1006-1	Principal's Office Break Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1007-1	Main Office Copy Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-1	Faculty Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-2	Faculty Room Bathroom 1	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-3	Faculty Room Bathroom 2 (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-4	Faculty Room Bathroom 2 (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1009-1	Cafeteria North	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1010-1	Cafeteria Boy's Bathrom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1011-1	Cafeteria Girl's Bathoom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1011-2	Cafeteria Girl's Bathoom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-1	Hall by Room 174	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-2	Hall by Room 174	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1013-1	Boy's Bathroom by Room 174 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1013-2	Boy's Bathroom by Room 174 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1013-3	Boy's Bathroom by Room 174 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1013-4	Boy's Bathroom by Room 174 @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1014-1	Custodial Closet by Room 174	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1015-1	Girl's Bathroom by Room 174 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1015-2	Girl's Bathroom by Room 174 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1015-3	Girl's Bathroom by Room 174 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1015-4	Girl's Bathroom by Room 174 @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1016-1	Nurse's Office Bathroom	SK	App	3.78	2/26/2021	-	-	-	None	-	-	-
1017-1	Hall by Weight Room	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1018-1	Boy's Bathroom by Weight Room (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1018-2	Boy's Bathroom by Weight Room (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1019-1	Custodial Closet by Weight Room	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1020-1	Boy's Locker Room Bathroom @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1020-2	Boy's Locker Room Bathroom @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1020-3	Boy's Locker Room Bathroom @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1020-4	Boy's Locker Room Handicap Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1021-1	Hall by North Gym	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1021-2	Hall by North Gym	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1022-1	Trainer's Room Ice Machine	IM	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1022-2	Trainer's Room	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-1	Girl's Locker Room Bathroom @A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-2	Girl's Locker Room Bathroom @B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-3	Girl's Locker Room Bathroom @C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-4	Girl's Locker Room Handicap Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1024-1	Custodial Closet by Elevator	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1025-1	Girl's Bathroom by Room 102 (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1025-2	Girl's Bathroom by Room 102 (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1026-1	Hall by Room 102	BF	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1026-2	Hall by Room 102	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2001-1	Assistant Principal's Break Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2002-1	Hall by Room 251	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
2003-1	Girl's Bathroom by 251 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2003-2	Girl's Bathroom by 251 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2003-3	Girl's Bathroom by 251 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2003-4	Girl's Bathroom by 251 @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2003-5	Girl's Bathroom by 251 @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2004-1	Staff Women's Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2004-2	Staff Women's Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2005-1	Staff Men's Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2005-2	Staff Men's Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2006-1	Hall by Room 235	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2007-1	Boy's Bathroom by Room 235 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-2	Boy's Bathroom by Room 235 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2007-3	Boy's Bathroom by Room 235 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-4	Boy's Bathroom by Room 235 @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-5	Boy's Bathroom by Room 235 @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-6	Boy's Bathroom by Room 235 @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-7	Boy's Bathroom by Room 235 @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2007-8	Boy's Bathroom by Room 235 @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2008-1	Custodial Closet by Room 231	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2009-1	Hall by Room 230	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2010-1	Hall by Room 272	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
2011-1	Boy's Bathroom by Room 272 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-2	Boy's Bathroom by Room 272 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2011-3	Boy's Bathroom by Room 272 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2012-1	Girl's Bathroom by Room 272 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2012-2	Girl's Bathroom by Room 272 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2012-3	Girl's Bathroom by Room 272 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2013-1	Staff Bathroom by Room 273	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2014-1	Custodial Closet by Room 270	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-1	Room 271 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-2	Room 271 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-3	Room 271 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2015-4	Room 271 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-5	Room 271 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-6	Room 271 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-7	Room 271 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-8	Room 271 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-9	Room 271 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-10	Room 271 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-11	Room 271 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-12	Room 271 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2015-13	Room 271 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-1	Room 270 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-2	Room 270 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-3	Room 270 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-4	Room 270 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-5	Room 270 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-6	Room 270 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-7	Room 270 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-8	Room 270 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-9	Room 270 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-10	Room 270 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2016-11	Room 270 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-12	Room 270 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2016-13	Room 270 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-1	Room 272 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-2	Room 272 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-3	Room 272 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-4	Room 272 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-5	Room 272 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-6	Room 272 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-7	Room 272 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-8	Room 272 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-9	Room 272 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-10	Room 272 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-11	Room 272 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-12	Room 272 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2017-13	Room 272 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-1	Room 273 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-2	Room 273 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-3	Room 273 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-4	Room 273 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-5	Room 273 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-6	Room 273 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-7	Room 273 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-8	Room 273 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-9	Room 273 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-10	Room 273 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-11	Room 273 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-12	Room 273 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2018-13	Room 273 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2019-1	Hall by Room 217	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2020-1	Room 217 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-2	Room 217 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-3	Room 217 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-4	Room 217 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-5	Room 217 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-6	Room 217 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-7	Room 217 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-8	Room 217 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-9	Room 217 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-10	Room 217 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2020-11	Room 217 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-12	Room 217 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-13	Room 217 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-14	Room 217 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-15	Room 217 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2020-16	Room 217 Chemical Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-1	Room 216 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-2	Room 216 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-3	Room 216 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-4	Room 216 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-5	Room 216 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-6	Room 216 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-7	Room 216 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-8	Room 216 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-9	Room 216 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-10	Room 216 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-11	Room 216 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-12	Room 216 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-13	Room 216 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2021-14	Room 216 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2022-1	Room 218 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-2	Room 218 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-3	Room 218 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-4	Room 218 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2022-5	Room 218 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2023-1	Room 220	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-1	Room 221	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-2	Room 221 Dark Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2024-3	Room 221 Dark Room	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2025-1	Room 222 Art Sink @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2025-2	Room 222 Art Sink @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2025-3	Room 222 Art Sink @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2025-4	Room 222 Art Sink @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2025-5	Room 222 Art Sink @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2025-6	Room 222 Art Sink @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-1	Room 215 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-2	Room 215 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-3	Room 215 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-4	Room 215 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-5	Room 215 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2026-6	Room 215 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-7	Room 215 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-8	Room 215 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-9	Room 215 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-10	Room 215 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-11	Room 215 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-12	Room 215 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-13	Room 215 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-14	Room 215 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2026-15	Room 215 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-1	Room 214 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-2	Room 214 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-3	Room 214 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-4	Room 214 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-5	Room 214 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-6	Room 214 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-7	Room 214 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-8	Room 214 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-9	Room 214 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-10	Room 214 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2027-11	Room 214 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-12	Room 214 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-13	Room 214 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2027-14	Room 214 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-1	Room 213 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-2	Room 213 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-3	Room 213 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-4	Room 213 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-5	Room 213 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-6	Room 213 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-7	Room 213 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-8	Room 213 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-9	Room 213 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-10	Room 213 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-11	Room 213 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-12	Room 213 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-13	Room 213 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-14	Room 213 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2028-15	Room 213 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2029-1	Custodial Closet by 213	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2030-1	Room 212 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-2	Room 212 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-3	Room 212 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-4	Room 212 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-5	Room 212 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-6	Room 212 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-7	Room 212 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-8	Room 212 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-9	Room 212 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-10	Room 212 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-11	Room 212 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-12	Room 212 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-13	Room 212 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-14	Room 212 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2030-15	Room 212 Prep Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2031-1	Hall by Room 211	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2032-1	Room 211 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-2	Room 211 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-3	Room 211 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-4	Room 211 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2032-5	Room 211 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-6	Room 211 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-7	Room 211 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-8	Room 211 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-9	Room 211 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-10	Room 211 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-11	Room 211 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-12	Room 211 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-13	Room 211 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2032-14	Room 211 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-1	Room 210 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-2	Room 210 Side Counter	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-3	Room 210 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-4	Room 210 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-5	Room 210 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-6	Room 210 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-7	Room 210 Counter @ E	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-8	Room 210 Counter @ F	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-9	Room 210 Counter @ G	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-10	Room 210 Counter @ H	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2033-11	Room 210 Counter @ I	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-12	Room 210 Counter @ J	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-13	Room 210 Counter @ K	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2033-14	Room 210 Counter @ L	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2034-1	Room 204 Teacher's Station	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2034-2	Room 204 Counter @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2034-3	Room 204 Counter @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2034-4	Room 204 Counter @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
2034-5	Room 204 Counter @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
0001-1	Basement Custodial Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210788-17027

March 1, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Half Hollow Hills High School West

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 26, 2021. New York Environmental analyzed the samples on March 01, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	26 Feb 2021
Date Received:	26 Feb 2021
Date Analyzed:	01 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210226K002	1	Kitchen Prep by Slicer-SK; Initial	1.00	2.24	µg/L	
210226K003	2	Kitchen Prep by Slicer-SPY; Initial	1.00	1.35	µg/L	
210226K004	3	Kitchen Pot Filler-PF; Initial	1.00	12.4	µg/L	
210226K005	4	Kitchen Prep by Pot Filler-SK; Initial	1.00	2.99	µg/L	
210226K006	5	Cafeteria South-BF; Initial	1.00	<1.00	µg/L	
210226K007	6	Home Economics Room 151 Station 1-SK; Initial	1.00	1.40	µg/L	
210226K008	7	Home Economics Room 151 Station 2-SK; Initial	1.00	1.52	µg/L	
210226K009	8	Home Economics Room 151 Station 3-SK; Initial	1.00	4.66	µg/L	
210226K010	9	Home Economics Room 151 Station 4-SK; Initial	1.00	43.4	µg/L	H
210226K011	10	Hall by Room 174-BF; Initial	1.00	<1.00	µg/L	
210226K012	11	Nurse's Office Bathroom-SK; Initial	1.00	3.78	µg/L	
210226K013	12	Hall by North Gym-BF; Initial	1.00	<1.00	µg/L	
210226K014	13	Trainer's Room -IM; Initial	1.00	<1.00	µg/L	
210226K015	14	Hall by Room 102-SK; Initial	1.00	<1.00	µg/L	
210226K016	15	Hall by Room 251-SK; Initial	1.00	<1.00	µg/L	
210226K017	16	Hall by Room 272-SK; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix L

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Lobby	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1001-2	Lobby	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1002-1	Pool (Near Girl's Locker Room)	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1003-2	Pool (Near Boy's Locker Room)	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1004-1	Women's Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1004-2	Women's Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-1	Girl's Locker Room Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-2	Girl's Locker Room Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1006-1	Men's Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1006-2	Men's Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1007-1	Boy's Locker Room (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1007-2	Boy's Locker Room (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1008-1	Girl's Coach's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1009-1	Boy's Coach's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1010-1	Pump Room	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210786-17025

March 1, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Natatorium; 375 Wolf Hill Road, Dix Hills, NY

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 26, 2021. New York Environmental analyzed the samples on March 01, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	26 Feb 2021
Date Received:	26 Feb 2021
Date Analyzed:	01 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210226J032	1	1001-2 Pool Lobby Area-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix M

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Lounge (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-2	Lounge (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-3	Lounge Ice Machine	IM	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1002-1	Mail Room Office Kitchenette	SK	App	19.9	2/26/2021				Additional Sampling Required			
1002-2	Mail Room Office Kitchenette	SPY	App	10.5	2/26/2021	-	-	-	None	-	-	-
1003-1	Office Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1003-2	Office Kitchenette	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1004-1	Custodial Closet by Lounge	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-1	Lounge Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-2	Lounge Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1006-1	Custodial Office Toilet	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1006-2	Custodial Office Toilet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1007-1	Hall by Conference Room	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1007-2	Hall by Conference Room	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1008-1	Conference Room Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1009-1	Superintendent's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1010-1	Main Office Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1010-2	Main Office Kitchenette	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1011-1	Hall by Room 102	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1011-2	Hall by Room 102	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-1	Office 102 Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1012-2	Office 102 Kitchenette	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1013-1	Office 104 Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1014-1	D.W.A. Office Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1014-2	D.W.A. Office Kitchenette	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1014-3	D.W.A. Office Kitchenette Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1015-1	Assistant Superintendant's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1016-1	Secretary's Office Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1017-1	M.I.S Secretary's Office Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1017-2	M.I.S Secretary's Office Kitchenette	SPY	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1018-1	Women's Bathroom by Room 106 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1018-2	Women's Bathroom by Room 106 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1018-3	Women's Bathroom by Room 106 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1019-1	Hall by Room 106	SK	N/A		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1020-1	Custodial Closet by Room 106	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1021-1	Men's Bathroom by Room 106 @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1021-2	Men's Bathroom by Room 106 @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1021-3	Men's Bathroom by Room 106 @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1022-1	Room 107 Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1023-1	Room 108 Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-1	Room 111 Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1025-1	Boardroom Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1026-1	Unisex Faculty Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1027-1	Women's Bathroom by Board Room @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1027-2	Women's Bathroom by Board Room @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1027-3	Women's Bathroom by Board Room @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1027-4	Women's Bathroom by Board Room @ D	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1028-1	Custodial Closet by Board Room	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1029-1	Men's Bathroom by Board Room @ A	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1029-2	Men's Bathroom by Board Room @ B	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1029-3	Men's Bathroom by Board Room @ C	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1030-1	Office Bathroom by Gym	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1031-1	Room 203 Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1032-1	Hall by Room 204	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1032-2	Hall by Room 204	BF	App	<1.0	2/26/2021	-	-	-	None	-	-	-
1033-1	Room 211 Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210784-17023

March 1, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Fran Greenspan Administration Center

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 26, 2021. New York Environmental analyzed the samples on March 01, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	26 Feb 2021
Date Received:	26 Feb 2021
Date Analyzed:	01 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210226J023	1	1002-1 Mail Room Kitchenette-SK; Initial	1.00	19.9	µg/L	H
210226J024	2	1002-2 Mail Room Kitchenette-SP; Initial	1.00	10.5	µg/L	
210226J025	3	1001-2 Lounge-IM; Initial	1.00	<1.00	µg/L	
210226J026	4	1007-2 Hall by Conference Rm-BF; Initial	1.00	<1.00	µg/L	
210226J027	5	1011-2 Hall by Room 102-BF; Initial	1.00	<1.00	µg/L	
210226J028	6	1032-2 Hall by Room 204-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix N

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
Transportation Building												
1001-1	Driver's Lounge	WF	App		2/26/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1001-1	Driver's Lounge	BF	App	<1.0	2/26/2021	-	-	-	None		-	-
1002-1	Men's Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1002-2	Men's Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1003-1	Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1004-1	Women's Bathroom (left)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1004-2	Women's Bathroom (right)	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1005-1	Secretary's Office Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1006-1	Kitchenette	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1007-1	Maintenance Area	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
Maintenance Building												
1001-1	Maintenance Shop	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1001-2	Maintenance Shop	WF	App	<1.0	2/26/2021	-	-	-	None		-	-
1001-3	Maintenance Shop	BF	App	<1.0	2/26/2021	-	-	-	None		-	-
1001-4	Maintenance Shop	IM	App	<1.0	2/26/2021	-	-	-	None		-	-
1002-1	Unisex Locker Room Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1003-1	Men's Locker Room Bathroom	SK	N/A		2/26/2021	-	-	-	None	SIGN	-	-
1004-1	Electrical/Custodial Closet	SS	N/A		2/26/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2210787-17026

March 1, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Transportation/ Bus Garage; 25 Burrs Lane, Dix Hills, NY

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 26, 2021. New York Environmental analyzed the samples on March 01, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	26 Feb 2021
Date Received:	26 Feb 2021
Date Analyzed:	01 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210226K001	1	1001-2 Drivers Lounge-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2210785-17024

March 1, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: AKBSF Maintenance Bldg

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on February 26, 2021. New York Environmental analyzed the samples on March 01, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	26 Feb 2021
Date Received:	26 Feb 2021
Date Analyzed:	01 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210226J029	1	1001-2 Maintenance Shop-WF; Initial	1.00	<1.00	µg/L	
210226J030	2	1001-3 Maintenance Shop-BF; Initial	1.00	<1.00	µg/L	
210226J031	3	1001-4 Maintenance Shop-IM; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation